



XPR LAGUNA SOUND

→ 20MIL
WEAR LAYER

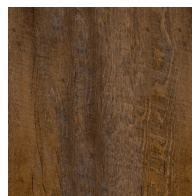


Rusty Pier

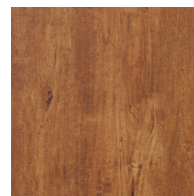


Antique Cedar




Caramel Bay

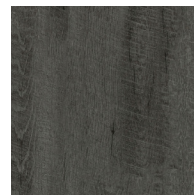

Oyster Gray

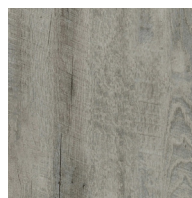

Silver Shell

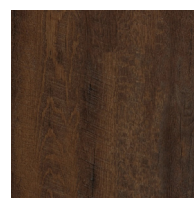





Spice Log



White Coral



XPR LAGUNA SOUND

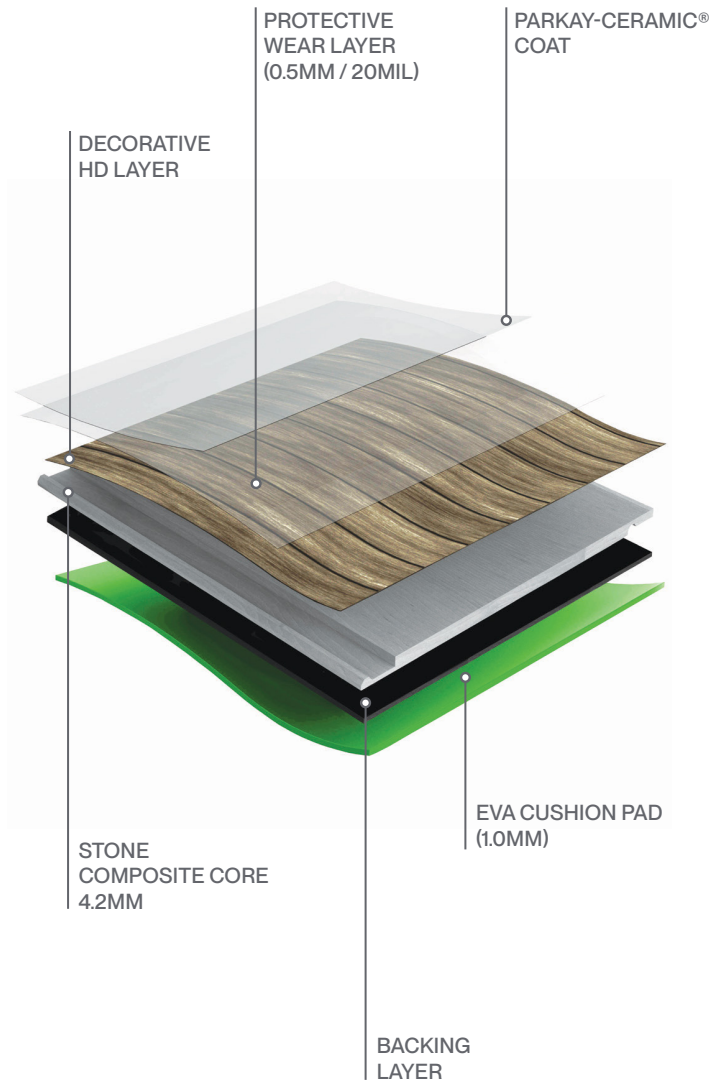

XPR LAGUNA SOUND

TECHNICAL DATA

VALUES

PRODUCT	LUXURY VINYL PLANK
COLLECTION	XPR LAGUNA SOUND
FINISH	REGISTERED EMOSS
EDGE TYPE	V-GROOVE
INSTALLATION TYPE	FR, GC
WATER ABSOT.	≤2%
THICK	5.2 MM
WIDTH	7"
LENGTH	48"
WEAR LAYER	20 MIL/0.5 MM
UNIQUE PLANKS	7
PLANKS/BOX	10
SQFT/BOX	23.64
BOX/PALLET	45
BOX/WEIGHT	41
WEIGHT/PALLET LB	2,255
PALLET SIZE L X W X H	49"X39"X25"
PALL/20' FCL	20
RESIDENTIAL WARRANTY	25 YEARS
COMMERCIAL WARRANTY	7 YEARS
FORCE OF BREAKAGE	N/A
RESISTANCE TO THE FLEXION	N/A
RESISTANCE TO ABRASION	EN649: M
FROST RESISTANCE	N/A
RESISTANCE TO THE SLIDING	R9
FIRE RESISTANCE	EN 13501-1: BF-S1 / ASTM E648-10: PASS/CLASS 1
FRICTION COEFFICIENT	$\mu \geq 0,30$ "
ACIDS AND BASICS	N/A
CARB 2 CERFITIED	N/A
BREAKING STRENGTH	N/A
COEFFICIENT OF STATIC FRICTION	DRY:0.27-WET:0.40
MADE IN	CHINA/VIETNAM

INSTALLATION INSTRUCTIONS

1. Read Parkay Floors® installation instructions before beginning.
2. Product cannot be used for exterior applications.
3. PARKAY XPR FLOORING has a patented locking system making it ideal for a floating installation. This product must be glued down using a pressure sensitive adhesive, when used for light traffic commercial applications.
4. Avoid constant exposure to excessive temperatures or direct sunlight for extended periods of time, as this might cause planks to peak, separate or decolorate. Please consider these exposures when choosing your product. Parkay Floors® recommends the use of windows shades, to protect your floor from direct sunlight for long periods.
5. PARKAY XPR FLOORING does not need to be acclimated if stored and installed in a temperate-controlled environment, maintained between 60°F and 85°F. Additional acclimation must be considered when temperatures mentioned above are not met. Store flat and fully supported during shipping and storage. It is not necessary to remove material from packaging while acclimating. Allow the product to condition in the room where installation is to take place if not maintained at a constant temperature between 60°F and 85°F or 18°C – 29°C, for a period of 48 hours prior to installation.
6. Slight variations in color and grain patterns are designed to enhance the natural appearance of the product. Mixing the planks creates a more uniform appearance. Make sure to shuffle planks from different cartons prior to installation.
7. Check PARKAY XPR FLOORING for possible defects prior to the installation. Complaints can only be accepted prior to installation. Parkay Floors® will not be responsible, or will compensate for any installation, if the floor was installed having an obvious or even a minor visual defect. Double check that the selected color coordinates with your initial sample and that the color name corresponds with the agreed order.
8. Unless PARKAY XPR is installed by using a Glue down installation method, performing a floating installation for the following use cases may present stress and compromise the locking system:
 - A. Areas where walkers, wheelchairs (i.e.), residential and or with extended care use.
 - B. Facilities with movement of heavy displays, racks, office chairs, dentist chairs, etc.
9. Parkay Floors® strongly recommends the final customer verify the chosen product in person prior to installation, since claims can not be brought up in regards to color, product name or design after the material has been installed.
10. Entryways must always be covered with walk off mats and rolling chairs with chair mats.
11. Moisture content on the subfloor must not exceed 5 lbs./1000ft²/24-hr (ASTMF2170), for this product to be installed.
12. Always cover furniture feet/legs with proper materials, such felt pads or similar fabric products.
13. Fixed cabinets or heavy objects cannot be installed over the floor when performing a floating installation.
14. Do not install this product over carpet.
15. Underlayment is not necessary for collections carrying an attached underlayment.
16. Transition moldings are required to separate any area exceeding 2,500 square feet or 50 lineal feet.

THE SUBFLOOR

1. Although PARKAY XPR FLOORING planks are water/moisture proof, they are not to be used as a moisture barrier. Your subfloor should be completely dry prior to installation. Keep in mind that constant moisture coming from the subfloor or topically, will cause mold and mildew to be trapped underneath the product, contributing to an unhealthy environment. Parkay Floors® will not warrant any product based on damages caused by excessive moisture. Subfloors presenting vapor emissions between 2.5% to 5% (CM-Method), must install a 6mil Poly-plastic block before laying the cushioned underlayment or flooring planks. All concrete subfloors must use poly-plastic block for extra moisture protection. Parkay Floors® recommends Polyguard 6 as an ideal poly-plastic block for extra moisture protection.

2. Subfloors must be structurally sound, solid, stable, level, plumb, and true to a tolerance in plane of 3/16" in 10 feet (4.7mm in 4m). Cracks, holes, grout lines must be filled with a fast-drying setting cement-based polymer modified patching compound or equivalent. Any unevenness over 3/16" (4.7mm) must be sanded down, leveled or ramped to a 0°. The surface must be totally clean of dirt, oil, glue residue, etc. Carpet tackles, staples or adhesive residue should be removed prior to installation. Voids or humps in the subfloor will prevent the planks from locking properly.

3. PARKAY XPR FLOORING can be installed on existing firm floors (Linoleum, PVC), but all floating or textile floors must be removed. When laying the floor over existing ceramic tiles, first level with fast setting cement-based polymer modified patching compound.

4. The installer has the final responsibility to determine if the subfloor is dry and leveled enough to begin with the installation. The professional must also make sure the product ready to be installed, corresponds with the chosen sample and the name on the boxes matches with the agreed order.

This product has an attached underlayment. Additional underlayment may not be used. For commercial applications, this product must be glued down using a pressure sensitive adhesive.

5. An expansion gap must be left around the perimeter. The ideal expansion gap must be equal to the total thickness of the product installed.

MEASUREMENTS

1. Agree with the client on which direction the floorboards should run since this influences the visual size ratio of the space. Installation parallel to the longest wall or the main light-source is recommended for the best visual effect.

2. Pre-plan the floor by measuring the room first. If the width of the last row is less than 2" (5cm) saw the first and the last plank in equal width.

3. Snap the lines on the substrate to identify the layout reference points. Planks should be set using this reference to ensure boards are aligned and will lock together correctly.

4. In large areas where flooring will span more than 50' long, an expansion gap should be used, place expansion space by using a transition molding in all narrow spaces below 3 ft and around the door jambs.

5. An expansion gap must be left around the perimeter. The ideal expansion gap must be equal to the total thickness of the product installed.

DIFFERENT PRODUCTION RUNS

PARKAY XPR FLOORING can have slight color variations in between production runs. Before starting the installation, it is best to check the production run # which is indicated on the label on the carton. If you find that you have cartons from different production runs, it is highly recommended to open a few cartons and install a mix of planks from each different production run on your floor. This will result in a more natural looking floor.


Do NOT install your Parkay Flooring over soft subfloors such as carpet, floating floors, or additional underlayment. This will automatically void your manufacturing warranty.

Although the use of pull bar and tapping block is recommended to ensure a successful install, make sure to not brake or damage the edges of the plank, since will compromise the locking system.


PARKAY XPR FLOORING provides a very tight fit. Proper care must be used to ensure all seams are tight at end of install. An unprofessional installation or use of improper tools can result in damage to the Click profiles. How to shorten doorframes: Position a loose plank face down, close to the doorframe, and cut with a jamb saw.

People can walk on the flooring immediately after the installation. Remove the wedges. Nail or screw the transition or baseboard moldings to the wall or subfloor, never to the floor.


FLOOR INSTALLATION

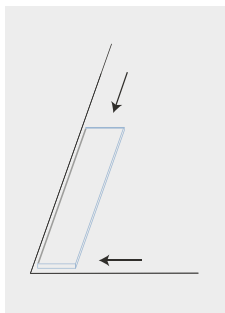


1→

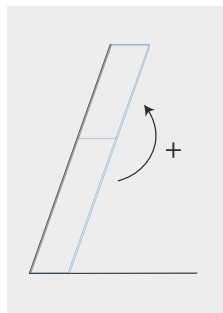


2→

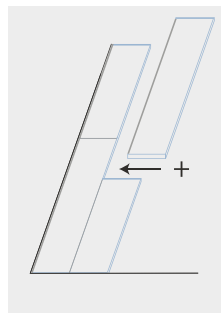


3→

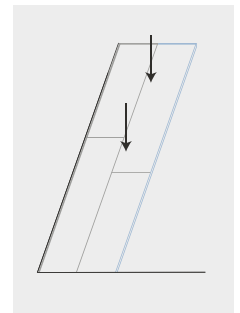


4→

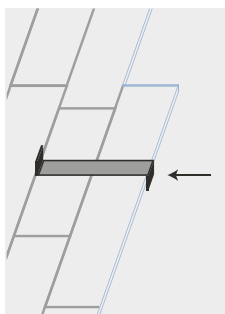

5→

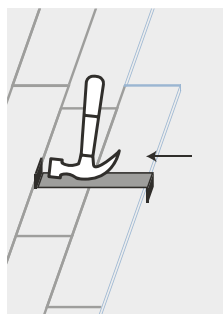

6→

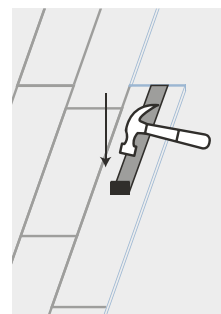

7

FLOOR INSTALLATION

First row:

Diagram 1: Start with the first plank in the left corner of the room, tongue-side facing out from the wall to the length and to the right on the width. Work from left to right.

Diagram 2: Position the following planks as an exact extension of the first one.

Cut to fit the last plank of the row. To do this you can use a utility knife to score the surface at the appropriate point and then break the tile over an edge. A laminate cutter or miter saw can be used as well.

Following rows:

Diagram 3: Begin the second row with the cut-off end to start the next and subsequent rows. Allow at least an 8" stagger for the end seams. For positioning the planks together, starting with the first tile in the row, raise the plank at a 45-degree angle, insert the lengthways tongue into the lengthways groove and lower the plank while holding the two together until they are flat and tightly together. Close the join using hand pressure, tapping block or pull bar.

Diagram 4: Lever the next sheet in place from the front side so that only a very short distance remains for it to be pushed into the lengthways connection.

Diagram 5, 6 and 7: Raise the plank slightly and push it into the lengthways tongue, first close to the front connection, then the rest. Make sure seams are tight on ends and sides using pull bar or tapping block before proceeding. Continue the installation to the last row of sheets, as described.

How to shorten doorframes: Position a loose plank face down, close to the doorframe, and cut with a jamb saw.

People can walk on the flooring immediately after the installation. Remove the wedges. Nail or screw the transition or baseboard moldings to the wall or subfloor, never to the floor.

INSTALLATION OVER RADIANT HEATED SUBFLOORS

PARKAY XPR FLOORING is not recommended to be installed over any electrical radiant heating systems. Only radiant heated system using water are recommended. Max heating temperate must not exceed 85°F. These Instructions must be followed:

Before installing, make sure to test the heating system at its maximum capacity to force out any residual moisture and to make sure it's working properly.

Moisture content on screed must not exceed 1.5%.

Shut down the heating system at least 48 hours prior to installation.

Keep room temperate between 60°F and 85°F during the installation.

After flooring is install, turn on the heating system gradually, from minimum to maximum within 1-hour period.

MAINTENANCE

Clean regularly with a damp mop with a vinyl floor cleaner such as Bona Pro Series Vinyl Cleaner. Do not use excessive water. Remember to clean up spills as soon as possible. Always use chair protectors under furniture and on chair legs. Felt pad protectors are best. Always add floor mats on area where rolling chairs are being used.

25 YEARS RESIDENTIAL / 7 YEARS LIGHT COMMERCIAL WARRANTY

Our 7 years limited light commercial warranty is for seven years from the date of purchase and from the original owner, and first installation of the product. When complied with the aforementioned your floor will be free from manufacturing defects, and will not wear through when installed and maintained according to instructions supplied with each carton. This warranty applies only to the original end user with a proof of purchase. Warranty is non transferable. Floors must have been installed by a licensed and insured professional to be able to process any claim. This warranty covers the replacement or refund of the material only, no labor. Claims for wear must show a minimum dime size area. High-heeled shoes, rolling carts, furniture and chairs without protective pads can damage the floor and such areas will not be covered by this warranty.

Warranty covers against: Staining, Wear, Fading as a result of natural or artificial light, damage by moisture from everyday household spills and manufacturing defects. Floor will only be replaced for one of the same monetary value.

If more than 5% of the product pulled out of the cartons is showing defects, stop the installation immediately and contact your Parkay Floors® representative. Transition moldings are not covered under this warranty. Scratches and loss of gloss are not considered a wear-through issue. Up to 10% gloss variance is considered completely normal between planks.

This warranty excludes damage by natural disasters. This warranty excludes floors in contact with moisture trapped beneath the floor. The general warranty is pro rata (25 years for flooring). A pro rata warranty is one that provides for a refund or credit that decreases according to a set formula as the warranty period progresses. A claim process takes up to 90 days to process, from the date Parkay Floors® is contacted. We require a detailed description with images of the issue that clearly show the problem. Contact Parkay Floors® dealer no later than 15 days after the discovery of the defect. Your dealer will arrange for proper inspection and coordinate a resolution of your claim.

Parkay Floors® reserves the right to modify the contents of this warranty at any and without previous notice. Please refer to our website to obtain the latest version of our warranty.

For service under this warranty or technical questions, please go to www.parkayfloors.com or contact your local retailer.

Describe the problem and in many cases, the retailer can provide you with a solution.

XPR LAGUNA SOUND

TESTS & CERTIFICATIONS

TEST REPORT

for

Parkay Floors
10360 NW 53 St.
Sunrise, FL 33351
Alberto Garcia / 954-726-4515

Sound Transmission Loss Test

ASTM E 90 – 09 (2016) / E 413 – 16

On

**6 Inch (152 mm) Concrete Slab Floor- Ceiling Assembly
Overlaid with XPR - Parweabro Flooring**

Report Number: NGC 5019077

Assignment Number: G-1628

Test Date: 09/25/2019

Report Approval Date: 10/02/2019

Submitted by:

Anthony J. Rivers
Test Technician

Reviewed by:

Robert J. Menchetti
Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

NGC 5019077
Parkay Floors
10/02/2019
Page 2 of 5

Revision Summary:

Date	SUMMARY
Approval Date: 10/02/2019	Original issue date: 10/02/2019 Original NGCTS report: NGC 5019077

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Report Number: NGC 5019078

Page 3 of 5

Test Method: This test method conforms explicitly with the American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements – Designation: E 90 – 09 (2016) / E 413 - 16.

Specimen Description: 6 inch concrete slab floor ceiling assembly overlaid with, according to client, XPR – Parweabro Flooring.

The test specimen was a floor assembly and was observed to consist of the following:
All weights and dimension are averaged:

- 1 layer of, according to the client, XPR – Parweabro Flooring. The flooring was adhered to the concrete slab using Loctbond 500 adhesive. The adhesive was applied using a 4.76 mm x 4.76 mm x 3.97 mm (3/16 in. x 3/16 in. x 5/32 in.) V notch trowel. Measured thickness: 5.59 mm (0.22 in.), Measured weight: 8.74 kg/m² (1.79 PSF)
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.2 kg/m² (75.00 PSF)

The overall weight of the test assembly is: 374.89 kg/m² (76.79 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

Specimen size: 3657.6 mm x 4876.8 mm (12 ft. x 16 ft.)

Conditioning: Concrete slab cured for a minimum of 28 days. Adhesive cured a minimum of 24 hours.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data							
Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16							
Test Report: NGC 5019077				Date: 9/25/2019		Page 4 of 5	
Specimen Size [m²]:		17.8					
Source room				Receiving room			
Volume [m³]: 86		Volume [m³]: 127					
Rm Temp [°C]: 25		Rm Temp [°C]: 22					
Humidity [%]: 55		Humidity [%]: 57					
Sound Transmission Class STC [dB]: 50							
Sum of Unfavorable Deviations [dB]: 26							
Max. Unfavorable Deviation [dB]: 5		at		400		Hz	
Frequency	STL	L1	L2	d	Corr.	u.Dev.	ΔSTL
[Hz]	[dB]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	37	102.2	68.7	22.6	3.5		1.90
100	35	104.0	72.2	25.0	3.2		4.40
125	31	104.0	77.8	18.9	4.7	3	2.36
160	33	105.7	77.7	15.7	5.1	4	1.72
200	39	106.6	73.2	15.5	5.6	1	0.85
250	42	103.9	67.3	16.8	5.4	1	0.78
315	43	101.3	63.1	16.3	4.8	3	0.86
400	44	100.2	61.1	17.7	4.9	5	0.87
500	47	101.4	59.4	18.2	5.0	3	1.02
630	47	101.7	58.7	18.7	4.0	4	0.88
800	50	100.0	53.9	19.3	3.9	2	0.62
1000	55	98.3	48.0	19.0	4.7		0.37
1250	57	97.3	44.2	20.2	3.9		0.43
1600	61	97.5	40.8	21.6	4.3		0.77
2000	65	99.8	38.0	24.3	3.3		0.62
2500	68	101.2	36.2	26.8	2.9		1.17
3150	71	100.4	32.0	29.0	2.6		1.17
4000	73	97.8	27.2	33.2	2.4		1.61
5000	76	90.9	16.3	38.7	1.4		1.58
STL = Sound Transmission Loss, dB L1 = Source Room Level, dB L2 = Receiving Room Level, dB d = Decay Rate dB/second Δ STL = Uncertainty for 95% Confidence Level							

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data


Page 5 of 5

Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16

Test Report: NGC 5019077
 Test Date: 9/25/2019
 Specimen Size [m²]: 17.8

Sound Transmission Class STC = 50 dB

Frequency [Hz]	STL [dB]	ΔSTL
80	37	1.90
100	35	4.40
125	31	2.36
160	33	1.72
200	39	0.85
250	42	0.78
315	43	0.86
400	44	0.87
500	47	1.02
630	47	0.88
800	50	0.62
1000	55	0.37
1250	57	0.43
1600	61	0.77
2000	65	0.62
2500	68	1.17
3150	71	1.17
4000	73	1.61
5000	76	1.58

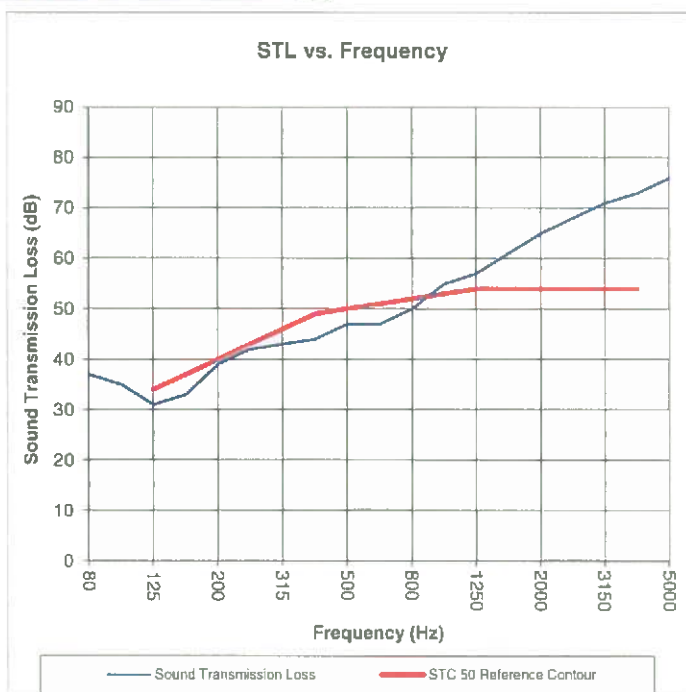

* Due to high insulating value of specimen, background levels limit results at these frequencies.

STL = Sound Transmission Loss, dB
 Δ STL = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

1650 Military Road • Buffalo, NY 14217-1198
(716) 873-9750 • Fax (716) 873-9753 • www.ngctestingservices.com

TEST REPORT

for

Parkay Floors
10360 NW 53 St.
Sunrise, FL 33351
Alberto Garcia / 954-726-4515

Sound Transmission Loss Test

ASTM E 90 – 09 (2016) / E 413 – 16

On

**6 Inch (152 mm) Concrete Slab Floor- Ceiling Assembly
Overlaid with XPR - Parweabro Flooring
With a Suspended-Gypsum Board Ceiling
With 3-1/2 Inch Fiberglass Insulation**


Report Number: NGC 5019078

Assignment Number: G-1628

Test Date: 09/27/2019

Report Approval Date: 10/02/2019

Submitted by:

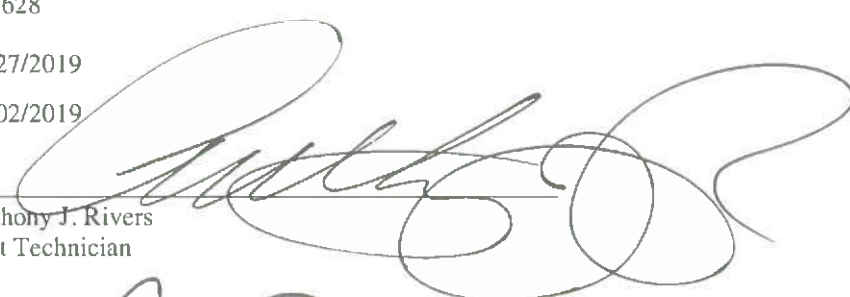
Anthony J. Rivers
Test Technician

Reviewed by:


Robert J. Menchetti
Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

NGC 5019078
Parkay Floors
10/02/2019
Page 2 of 5

Revision Summary:

Date	SUMMARY
Approval Date: 10/02/2019	Original issue date: 10/02/2019 Original NGCTS report: NGC 5019078

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Report Number: NGC 5019078

Page 3 of 5

Test Method: This test method conforms explicitly with the American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements – Designation: E 90 – 09 (2016) / E 413 – 16.

Specimen Description: 6 inch concrete slab floor suspended ceiling assembly overlaid with, according to client, XPR – Parweabro Flooring, with 3-1/2 inches of fiberglass insulation.

The test specimen was a floor assembly and was observed to consist of the following:
All weights and dimension are averaged:

- 1 layer of, according to the client, XPR – Parweabro Flooring. The flooring was adhered to the concrete slab using Locbond 500 adhesive. The adhesive was applied using a 4.76 mm x 4.76 mm x 3.97 mm (3/16 in. x 3/16 in. x 5/32 in.) V notch trowel. Measured thickness: 5.59 mm (0.22 in.), Measured weight: 8.74 kg/m² (1.79 PSF)
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.2 kg/m² (75.00 PSF)
- 1 layer of, 88.9 mm (3-1/2 in.) unfaced fiberglass batt insulation, Sample weight: 0.78 kg/m² (0.16 PSF)
- Gypsum wallboard ceiling grid suspension system. System is comprised of main tees and cross tees. The main tees were placed 1219.2 mm (48 in.) o.c. and the cross tees were placed 609.6 mm (24 in.) o.c. 16 gauge galvanized tie wire was used to attach the main tees to concrete anchors, located 1219.2 mm (48 in.) o.c. along the longitudinal axis, suspending the grid 304.8 mm (12 in.) below the concrete slab.
- 1 layer of, 15.9 mm (5/8 in.) Type X gypsum wallboard. The wallboard was attached parallel to the suspended grid suspension system mains, using 31.8 mm (1-1/4 in.) Type S drywall screws spaced 304.8 mm (12 in.) o.c. The wallboard joints were taped. Suspended gypsum wallboard grid ceiling weighed: 11.23 kg/m² (2.30 PSF)

The overall weight of the test assembly is: 386.90 kg/m² (79.25 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

Specimen size: 3657.6 mm x 4876.8 mm (12 ft. x 16 ft.)

Conditioning: Concrete slab cured for a minimum of 28 days. Adhesive cured a minimum of 24 hours.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data							
Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16							
Test Report: NGC 5019078				Date: 9/27/2019		Page 4 of 5	
Specimen Size [m²]:		17.8					
Source room				Receiving room			
Volume [m³]: 86		Volume [m³]: 127					
Rm Temp [°C]: 25		Rm Temp [°C]: 23					
Humidity [%]: 55		Humidity [%]: 58					
Sound Transmission Class STC [dB]: 61							
Sum of Unfavorable Deviations [dB]:		32					
Max. Unfavorable Deviation [dB]:		7		at 125 Hz			
Frequency	STL	L1	L2	d	Corr.	u.Dev.	ΔSTL
[Hz]	[dB]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	40	102.5	65.0	27.2	2.4		2.87
100	45	104.1	62.5	25.9	3.4		4.42
125	38	103.6	70.3	18.5	4.8	7	2.32
160	43	106.1	68.3	17.0	5.1	5	1.90
200	50	106.7	62.4	15.0	5.7	1	0.92
250	50	103.1	58.6	15.6	5.4	4	0.87
315	51	101.1	55.7	15.0	5.6	6	1.06
400	54	100.0	50.6	16.9	4.5	6	0.56
500	59	101.1	46.6	17.7	4.4	2	0.65
630	61	101.4	45.2	18.6	4.8	1	0.59
800	64	100.0	40.9	18.8	4.9		0.48
1000	68	97.9	34.9	18.3	5.0		0.35
1250	73	97.5	29.3	19.3	4.7		0.65
1600	74	97.2	27.2	20.8	4.0		0.46
2000	75	99.2	27.1	24.3	2.9		0.68
2500	77	101.1	27.0	27.0	2.9		0.89
3150	79	100.1	24.0	28.7	2.9		1.04
4000	81	97.9	18.6	32.6	1.7		1.47
5000	82	91.0	10.4	37.1	1.5		1.70
STL = Sound Transmission Loss, dB L1 = Source Room Level, dB L2 = Receiving Room Level, dB d = Decay Rate dB/second Δ STL = Uncertainty for 95% Confidence Level							

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data

Page 5 of 5


Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16

Test Report: NGC 5019078
 Test Date: 9/27/2019
 Specimen Size [m²]: 17.8

Sound Transmission Class STC = 61 dB

Frequency [Hz]	STL [dB]	ΔSTL
80	40	2.87
100	45	4.42
125	38	2.32
160	43	1.90
200	50	0.92
250	50	0.87
315	51	1.06
400	54	0.56
500	59	0.65
630	61	0.59
800	64	0.48
1000	68	0.35
1250	73	0.65
1600	74	0.46
2000	75	0.68
2500	77	0.89
3150	79	1.04
4000	81	1.47
5000	82	1.70

* Due to high insulating value of specimen, background levels limit results at these frequencies.

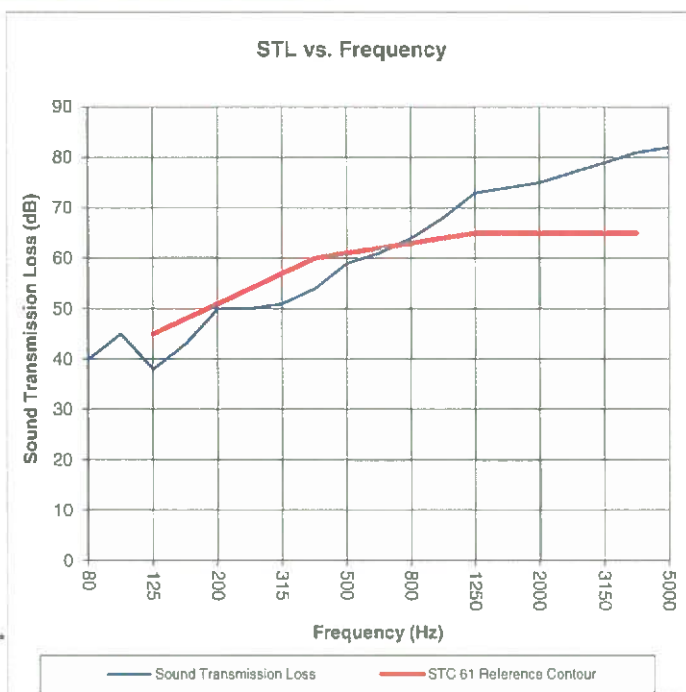

STL = Sound Transmission Loss, dB
 Δ STL = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

TEST REPORT

for

Parkay Floors
10360 NW 53 St.
Sunrise, FL 33351
Alberto Garcia / 954-726-4515

Sound Transmission Loss Test

ASTM E 90 – 09 (2016) / E 413 – 16

On

**6 Inch (152 mm) Concrete Slab Floor- Ceiling Assembly
Overlaid with XPR - Parweabro Flooring
With a Suspended-Gypsum Board Ceiling
With 3-1/2 Inch Fiberglass Insulation**


Report Number: NGC 5019078

Assignment Number: G-1628

Test Date: 09/27/2019

Report Approval Date: 10/02/2019

Submitted by:

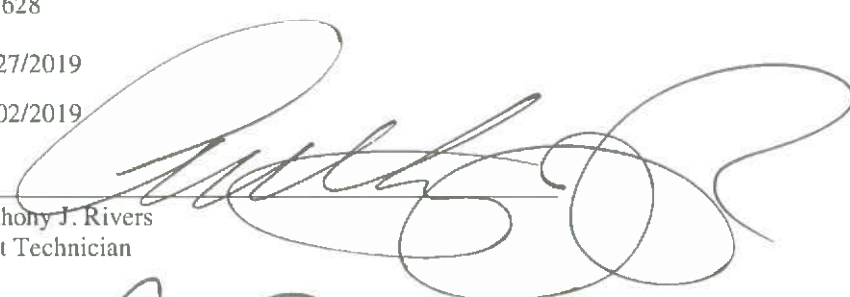
Anthony J. Rivers
Test Technician

Reviewed by:


Robert J. Menchetti
Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

NGC 5019078
Parkay Floors
10/02/2019
Page 2 of 5

Revision Summary:

Date	SUMMARY
Approval Date: 10/02/2019	Original issue date: 10/02/2019 Original NGCTS report: NGC 5019078

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Report Number: NGC 5019078

Page 3 of 5

Test Method: This test method conforms explicitly with the American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements – Designation: E 90 – 09 (2016) / E 413 – 16.

Specimen Description: 6 inch concrete slab floor suspended ceiling assembly overlaid with, according to client, XPR – Parweabro Flooring, with 3-1/2 inches of fiberglass insulation.

The test specimen was a floor assembly and was observed to consist of the following:
All weights and dimension are averaged:

- 1 layer of, according to the client, XPR – Parweabro Flooring. The flooring was adhered to the concrete slab using Locbond 500 adhesive. The adhesive was applied using a 4.76 mm x 4.76 mm x 3.97 mm (3/16 in. x 3/16 in. x 5/32 in.) V notch trowel. Measured thickness: 5.59 mm (0.22 in.), Measured weight: 8.74 kg/m² (1.79 PSF)
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.2 kg/m² (75.00 PSF)
- 1 layer of, 88.9 mm (3-1/2 in.) unfaced fiberglass batt insulation, Sample weight: 0.78 kg/m² (0.16 PSF)
- Gypsum wallboard ceiling grid suspension system. System is comprised of main tees and cross tees. The main tees were placed 1219.2 mm (48 in.) o.c. and the cross tees were placed 609.6 mm (24 in.) o.c. 16 gauge galvanized tie wire was used to attach the main tees to concrete anchors, located 1219.2 mm (48 in.) o.c. along the longitudinal axis, suspending the grid 304.8 mm (12 in.) below the concrete slab.
- 1 layer of, 15.9 mm (5/8 in.) Type X gypsum wallboard. The wallboard was attached parallel to the suspended grid suspension system mains, using 31.8 mm (1-1/4 in.) Type S drywall screws spaced 304.8 mm (12 in.) o.c. The wallboard joints were taped. Suspended gypsum wallboard grid ceiling weighed: 11.23 kg/m² (2.30 PSF)

The overall weight of the test assembly is: 386.90 kg/m² (79.25 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

Specimen size: 3657.6 mm x 4876.8 mm (12 ft. x 16 ft.)

Conditioning: Concrete slab cured for a minimum of 28 days. Adhesive cured a minimum of 24 hours.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data							
Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16							
Test Report: NGC 5019078				Date: 9/27/2019		Page 4 of 5	
Specimen Size [m²]:		17.8					
Source room				Receiving room			
Volume [m³]: 86		Volume [m³]: 127					
Rm Temp [°C]: 25		Rm Temp [°C]: 23					
Humidity [%]: 55		Humidity [%]: 58					
Sound Transmission Class STC [dB]: 61							
Sum of Unfavorable Deviations [dB]: 32							
Max. Unfavorable Deviation [dB]: 7		at		125		Hz	
Frequency	STL	L1	L2	d	Corr.	u.Dev.	ΔSTL
[Hz]	[dB]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	40	102.5	65.0	27.2	2.4		2.87
100	45	104.1	62.5	25.9	3.4		4.42
125	38	103.6	70.3	18.5	4.8	7	2.32
160	43	106.1	68.3	17.0	5.1	5	1.90
200	50	106.7	62.4	15.0	5.7	1	0.92
250	50	103.1	58.6	15.6	5.4	4	0.87
315	51	101.1	55.7	15.0	5.6	6	1.06
400	54	100.0	50.6	16.9	4.5	6	0.56
500	59	101.1	46.6	17.7	4.4	2	0.65
630	61	101.4	45.2	18.6	4.8	1	0.59
800	64	100.0	40.9	18.8	4.9		0.48
1000	68	97.9	34.9	18.3	5.0		0.35
1250	73	97.5	29.3	19.3	4.7		0.65
1600	74	97.2	27.2	20.8	4.0		0.46
2000	75	99.2	27.1	24.3	2.9		0.68
2500	77	101.1	27.0	27.0	2.9		0.89
3150	79	100.1	24.0	28.7	2.9		1.04
4000	81	97.9	18.6	32.6	1.7		1.47
5000	82	91.0	10.4	37.1	1.5		1.70
STL = Sound Transmission Loss, dB							
L1 = Source Room Level, dB							
L2 = Receiving Room Level, dB							
d = Decay Rate dB/second							
Δ STL = Uncertainty for 95% Confidence Level							

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

Sound Transmission Loss Test Data

Page 5 of 5

Test: ASTM E 90 - 09 (2016) / ASTM E 413 - 16

Test Report: NGC 5019078


Test Date: 9/27/2019

Specimen Size [m²]: 17.8

Sound Transmission Class STC = 61 dB

Frequency [Hz]	STL [dB]	ΔSTL
80	40	2.87
100	45	4.42
125	38	2.32
160	43	1.90
200	50	0.92
250	50	0.87
315	51	1.06
400	54	0.56
500	59	0.65
630	61	0.59
800	64	0.48
1000	68	0.35
1250	73	0.65
1600	74	0.46
2000	75	0.68
2500	77	0.89
3150	79	1.04
4000	81	1.47
5000	82	1.70

* Due to high insulating value of specimen, background levels limit results at these frequencies.

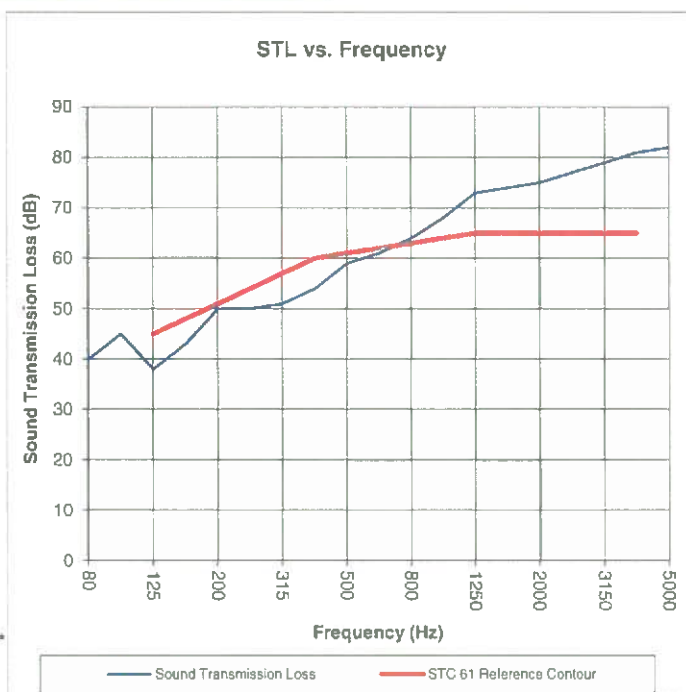

STL = Sound Transmission Loss, dB
 Δ STL = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

TEST REPORT

for

Parkay Floors
10360 NW 53 St.
Sunrise, FL 33351
Alberto Garcia / 954-726-4515

Impact Sound Transmission Test

ASTM E 492 – 09 (2016) / ASTM E 989 – 18

On

**6 Inch (152 mm) Concrete Slab Floor- Ceiling Assembly
Overlaid with XPR - Parweabro Flooring**

Report Number: NGC 7019102

Assignment Number: G-1628

Test Date: 09/25/2019

Report Date: 10/02/2019

Submitted by:

Anthony J. Rivers
Test Technician

Reviewed by:

Robert J. Menchetti
Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Revision Summary:

Date	SUMMARY
Approval Date: 10/02/2019	Original issue date: 10/02/2019 Original NGCTS report: NGC 7019102

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Report Number: NGC 7019103

Page 3 of 5

Test Method: This test method is in accordance with American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Sound Transmission Through Floor-Ceiling Assemblies Using the Tapping Machine - Designation: E 492-09 (2016) / E 989-18.

The uncertainty limits of each tapping machine location met the precision requirements of section A1.4 of ASTM E 492-09.

Specimen Description: 6 inch concrete slab floor ceiling assembly overlaid with, according to client, XPR – Parweabro Flooring.

The test specimen was a floor assembly and was observed to consist of the following:

All weights and dimension are averaged:

- 1 layer of, according to the client, XPR – Parweabro Flooring. The flooring was adhered to the concrete slab using Locbond 500 adhesive. The adhesive was applied using a 4.76 mm x 4.76 mm x 3.97 mm (3/16 in. x 3/16 in. x 5/32 in.) V notch trowel. Measured thickness: 5.59 mm (0.22 in.), Measured weight: 8.74 kg/m² (1.79 PSF)
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.2 kg/m² (75.00 PSF)

The overall weight of the test assembly is: 374.89 kg/m² (76.79 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

Specimen size: 3657.6 mm x 4876.8 mm (12 ft. x 16 ft.)

Conditioning: Concrete slab cured for a minimum of 28 days. Adhesive cured a minimum of 24 hours.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Normalized impact sound pressure level						
Test: ASTM E 492 - 09 (2016) / ASTM E 989 - 18						
Test Report: NGC7019102				Date: 9/25/2019		Page 4 of 5
Specimen Size [m ²]: 17.8						
Source room				Receiving room		
Rm Temp [°C]: 25				Volume [m ³]: 127		
Humidity [%]: 55				Rm Temp [°C]: 22		
				Humidity [%]: 57		
Impact Insulation Class IIC [dB]: 50						
Sum of Unfavorable Deviations [dB]: 29						
Max. Unfavorable Deviation [dB]: 8				at 125 Hz		
Frequency	L _n	L ₂	d	Corr.	u.Dev.	ΔL _n
[Hz]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	59	60.4	23.26	-1.4		1.48
100	57	58.3	21.53	-1.3		1.98
125	70	71.7	18.26	-1.7	8	2.02
160	67	69.6	15.71	-2.6	5	1.62
200	68	70.7	15.02	-2.7	6	0.65
250	69	71.6	16.03	-2.6	7	1.41
315	63	65.6	16.25	-2.6	1	0.48
400	63	65.0	17.74	-2.0	2	0.33
500	56	57.9	18.16	-1.9		0.41
630	52	53.5	18.71	-1.5		0.45
800	52	54.1	18.97	-2.1		0.42
1000	47	48.6	18.81	-1.6		0.53
1250	42	43.9	20.08	-1.9		0.58
1600	39	40.0	21.61	-1.0		0.78
2000	34	34.5	24.41	-0.5		0.71
2500	27	28.4	26.69	-1.4		0.82
3150	22	23.0	29.34	-1.0		0.96
4000	21	20.6	33.93	0.4		1.02
5000	19	18.2	38.12	0.8		1.12
L _n = Normalized Sound Pressure Level, dB L ₂ = Receiving Room Level, dB d = Decay Rate, dB/second ΔL _n = Uncertainty for 95% Confidence Level						

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

1650 Military Road • Buffalo, NY 14217-1198
(716) 873-9750 • Fax (716) 873-9753 • www.ngctestingservices.com

Normalized impact sound pressure level

Test: ASTM E 492 - 09 (2016) / ASTM E 989 - 18

Page 5 of 5


Test Report: NGC7019102

Test Date: 9/25/2019

Specimen Size [m²]: 17.8

Impact Insulation Class IIC [dB]: 50

Frequency	L _n
[Hz]	[dB]
80	59
100	57
125	70
160	67
200	68
250	69
315	63
400	63
500	56
630	52
800	52
1000	47
1250	42
1600	39
2000	34
2500	27
3150	22
4000	21
5000	19

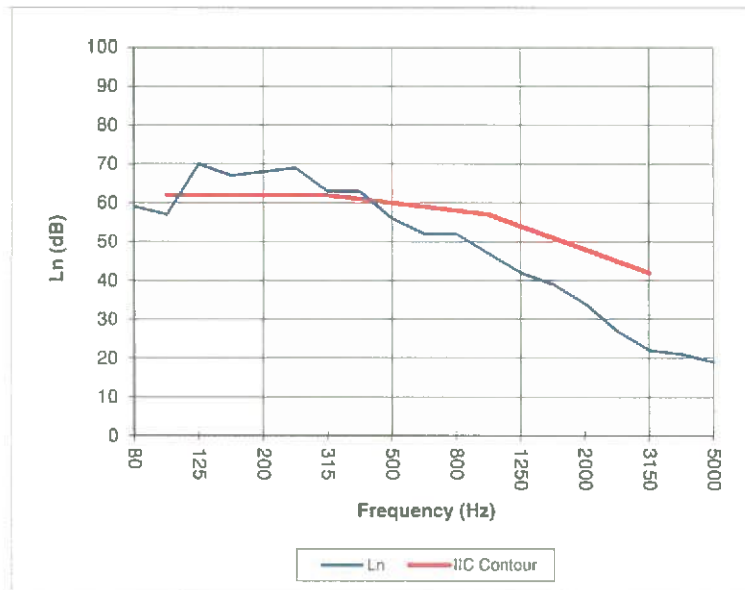

* Due to high insulating value of specimen, background levels limit results at these frequencies.

L_n = Normalized Sound Pressure Level, dB

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

TEST REPORT

for

Parkay Floors
10360 NW 53 St.
Sunrise, FL 33351
Alberto Garcia / 954-726-4515

Impact Sound Transmission Test

ASTM E 492 – 09 (2016) / ASTM E 989 – 18

On

**6 Inch (152 mm) Concrete Slab Floor- Ceiling Assembly
Overlaid with XPR - Parweabro Flooring
With a Suspended-Gypsum Board Ceiling
With 3-1/2 Inch Fiberglass Insulation**

Report Number: NGC 7019103

Assignment Number: G-1628

Test Date: 09/27/2019

Report Date: 10/02/2019

Submitted by:

Anthony J. Rivers
Test Technician

Reviewed by:

Robert J. Menchetti
Director

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Revision Summary:

Date	SUMMARY
Approval Date: 10/02/2019	Original issue date: 10/02/2019 Original NGCTS report: NGC 7019103

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Report Number: NGC 7019103

Page 3 of 5

Test Method: This test method is in accordance with American Society for Testing and Materials Standard Test Method for Laboratory Measurement of Sound Transmission Through Floor-Ceiling Assemblies Using the Tapping Machine - Designation: E 492-09 (2016) / E 989-18.

The uncertainty limits of each tapping machine location met the precision requirements of section A1.4 of ASTM E 492-09.

Specimen Description: 6 inch concrete slab floor suspended ceiling assembly overlaid with, according to client, XPR – Parweabro Flooring, with 3-1/2 inches of fiberglass insulation.

The test specimen was a floor assembly and was observed to consist of the following:
All weights and dimension are averaged:

- 1 layer of, according to the client, XPR – Parweabro Flooring. The flooring was adhered to the concrete slab using Loctbond 500 adhesive. The adhesive was applied using a 4.76 mm x 4.76 mm x 3.97 mm (3/16 in. x 3/16 in. x 5/32 in.) V notch trowel. Measured thickness: 5.59 mm (0.22 in.), Measured weight: 8.74 kg/m² (1.79 PSF)
- 152.4 mm (6 in.) thick reinforced concrete slab, weighing: 366.2 kg/m² (75.00 PSF)
- 1 layer of, 88.9 mm (3-1/2 in.) unfaced fiberglass batt insulation, Sample weight: 0.78 kg/m² (0.16 PSF)
- Gypsum wallboard ceiling grid suspension system. System is comprised of main tees and cross tees. The main tees were placed 1219.2 mm (48 in.) o.c. and the cross tees were placed 609.6 mm (24 in.) o.c. 16 gauge galvanized tie wire was used to attach the main tees to concrete anchors, located 1219.2 mm (48 in.) o.c. along the longitudinal axis, suspending the grid 304.8 mm (12 in.) below the concrete slab.
- 1 layer of, 15.9 mm (5/8 in.) Type X gypsum wallboard. The wallboard was attached parallel to the suspended grid suspension system mains, using 31.8 mm (1-1/4 in.) Type S drywall screws spaced 304.8 mm (12 in.) o.c. The wallboard joints were taped. Suspended gypsum wallboard grid ceiling weighed: 11.23 kg/m² (2.30 PSF)

The overall weight of the test assembly is: 386.90 kg/m² (79.25 PSF)

The perimeter of the test frame was sealed with a rubber gasket and a sand filled trough.

The test frame was structurally isolated from the receiving room.

Specimen size: 3657.6 mm x 4876.8 mm (12 ft. x 16 ft.)

Conditioning: Concrete slab cured for a minimum of 28 days. Adhesive cured a minimum of 24 hours.

Test Results: The results of the tests are given on pages 4 and 5 of the report.

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agency of the Federal Government. This report may not be reproduced except in full, without written approval of the laboratory.

Normalized impact sound pressure level						
Test: ASTM E 492 - 09 (2016) / ASTM E 989 - 18						
Test Report: NGC7019103				Date: 9/27/2019		
Specimen Size [m²]: 17.8				Page 4 of 5		
Source room				Receiving room		
Rm Temp [°C]: 25				Volume [m³]: 127		
Humidity [%]: 55				Rm Temp [°C]: 23		
				Humidity [%]: 58		
Impact Insulation Class IIC [dB]: 69						
Sum of Unfavorable Deviations [dB]: 30						
Max. Unfavorable Deviation [dB]: 8				at 125 Hz		
Frequency	L_n	L_2	d	Corr.	u.Dev.	ΔL_n
[Hz]	[dB]	[dB]	[dB/s]	[dB]	[dB]	
80	55	55.3	28.82	-0.3		2.43
100	50	50.3	25.81	-0.3	7	3.25
125	51	55.3	19.08	-4.3	8	0.90
160	50	52.3	17.87	-2.3	7	0.50
200	49	51.4	15.62	-2.4	6	0.75
250	45	47.8	15.61	-2.8	2	0.59
315	41	44.2	15.57	-3.2		0.47
400	37	40.4	16.50	-3.4		0.34
500	30	33.8	17.84	-3.8		0.36
630	27	31.3	18.10	-4.3		0.31
800	24	27.7	19.02	-3.7		0.45
1000	19	23.0	18.60	-4.0		0.63
1250	16	20.1	19.26	-4.1		1.23
1600	15	18.6	21.05	-3.6		2.27
2000	13	16.2	24.42	-3.2		2.18
2500	11	13.2	26.82	-2.2		1.41
3150	10	11.8	28.64	-1.8		1.22
4000	11	12.5	32.21	-1.5		1.70
5000	10	10.7	36.31	-0.7		1.20

L_n = Normalized Sound Pressure Level, dB
 L_2 = Receiving Room Level, dB
 d = Decay Rate, dB/second
 ΔL_n = Uncertainty for 95% Confidence Level

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

1650 Military Road • Buffalo, NY 14217-1198
(716) 873-9750 • Fax (716) 873-9753 • www.ngctestingservices.com

Normalized impact sound pressure level

Test: ASTM E 492 - 09 (2016) / ASTM E 989 - 18

Page 5 of 5


Test Report: NGC7019103

Test Date: 9/27/2019

Specimen Size [m²]: 17.8

Impact Insulation Class IIC [dB]: 69

Frequency	L _n
[Hz]	[dB]
80	55
100	50
125	51
160	50
200	49
250	45
315	41
400	37
500	30
630	27
800	24
1000	19
1250	16
1600	15
2000	13
2500	11
3150	10
4000	11
5000	10

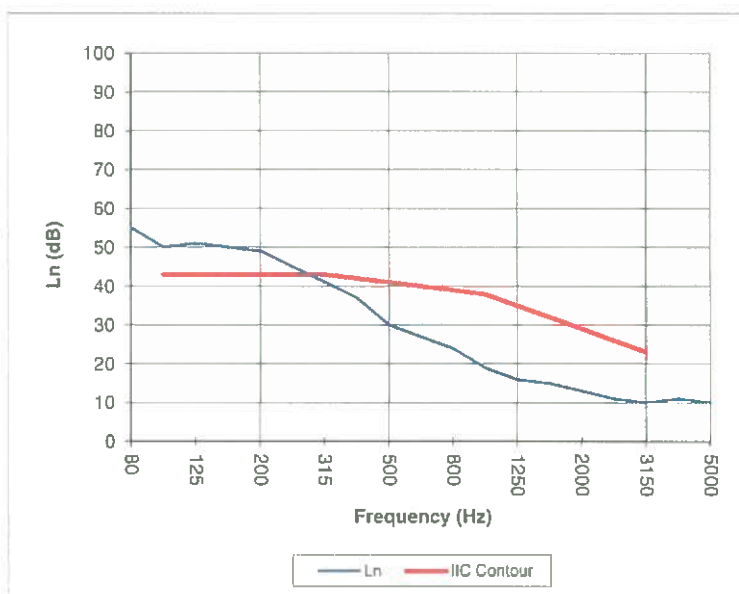

* Due to high insulating value of specimen, background levels limit results at these frequencies.

L_n = Normalized Sound Pressure Level, dB

The results reported above apply to specific samples submitted for measurement. No responsibility is assumed for performance of any other specimen. The laboratory's accreditation or any of its test reports in no way constitute or imply product certification, approval, or endorsement by NVLAP, NIST or any agent of the U.S. Government. This report may not be reproduced except in full, without written approval of the laboratory.

TEST REPORT

No. : XMIN180100115CCM

Date : Feb.14, 2018

Page: 1 of 6

CUSTOMER NAME:

ADDRESS:

Sample Name : RIGID LVT PLANK

Material : Vinyl

Spec. : 1220*180*5.0

Manufacturer :

Sample Information : 08/01/2018

Above information and sample(s) was/were submitted and confirmed by the client. SGS, however, assumes no responsibility to verify the accuracy, adequacy and completeness of the sample information provided by client.

Test Required : Selected test(s) as requested by applicant

SGS Ref. No. : SDHL1801001015FB

Date of Receipt : Jan.12, 2018

Testing Start Date : Jan.12, 2018

Testing End Date : Jan.22, 2018

Test Result Summary

No.	Test(s) Requested	Result(s)
1	CAN/ULC-S102.2-10	FSR:10 SDC:350
For further details, please refer to the following page(s) (Unless otherwise stated the results shown in this test report refer only to the sample(s) tested)		

***** To be continued*****

Signed for
SGS-CSTC Standards Technical
Services Co., Ltd. XM Branch

Bryan
Bryan Hong Authorized Signatory



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Standards Technical Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180100115CCM

Date : Feb.14, 2018

Page: 2 of 6

Test Conducted:

CAN/ULC-S102.2-10 Standard Method of Test for Surface Burning Characteristics of Flooring, Floor Coverings, and Miscellaneous Materials and Assemblies.

Sample Preparation:

Prior to testing, the specimen was conditioned to constant weight at a temperature of $(23 \pm 3^{\circ}\text{C})$ and a relative humidity of $50 \pm 5\%$.

The test specimen was placed on the ceramic fibre paper (Ceramic fibre paper with a area density of 0.7kg/m^2 , shall be laid on the floor of the test chamber beneath the test specimen.).

Test specimen width consisted of a total of 2 sections of material and butted together during testing to form the requisite specimen length.

Test Results:

Sample No.	Calculated Values	
	FSV (Flame spread Value)	SDV (Smoke developed Value)
1	10.7	328
2	11.2	360
3	11.2	364

Classification:

FSR(Flame Spread Rating) :10

SDC (Smoke Developed Classification):350

Remark:

FSR - Calculated the numerical average of the individual Flame Spread Values (FSV), then round the average to the nearest of 5 points. The rounded average is the Flame Spread Rating (FSR)

SDC - Calculated the numerical average of the individual Smoke Developed Values (SDV), then round the average to the nearest of 5 points. The rounded average is the Smoke Developed Classification (SDC)

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180100115CCM

Date : Feb.14, 2018

Page: 3 of 6

Graphical Results:

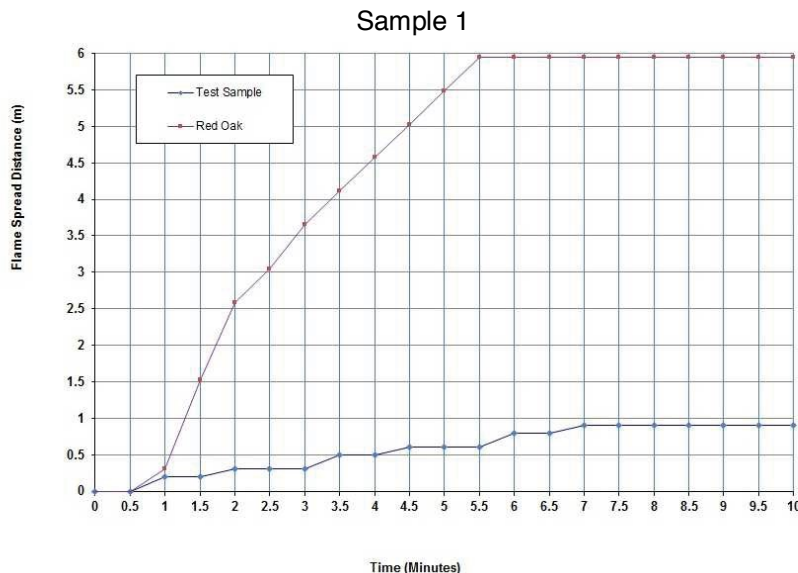


Figure 1. Flame Spread Chart

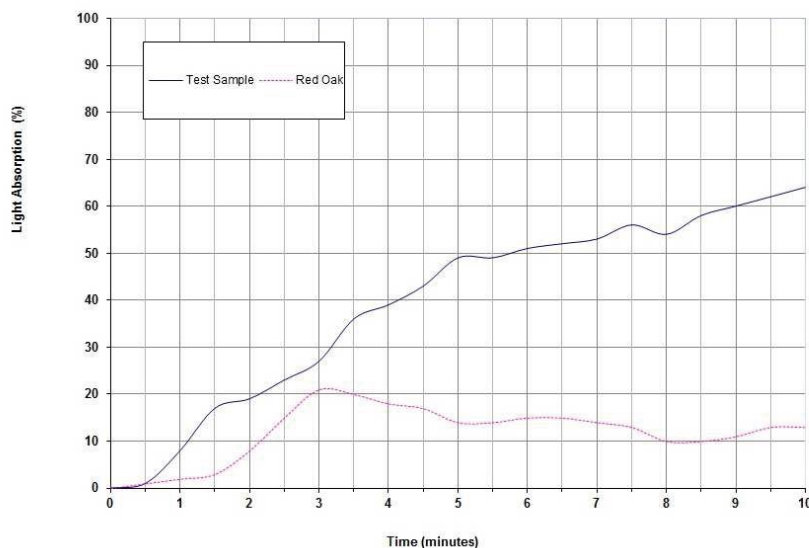


Figure 2. Smoke Developed Chart

***** To be continued*****

TEST REPORT

No. : XMIN180100115CCM

Date : Feb.14, 2018

Page: 4 of 6

Graphical Results:

Sample 2

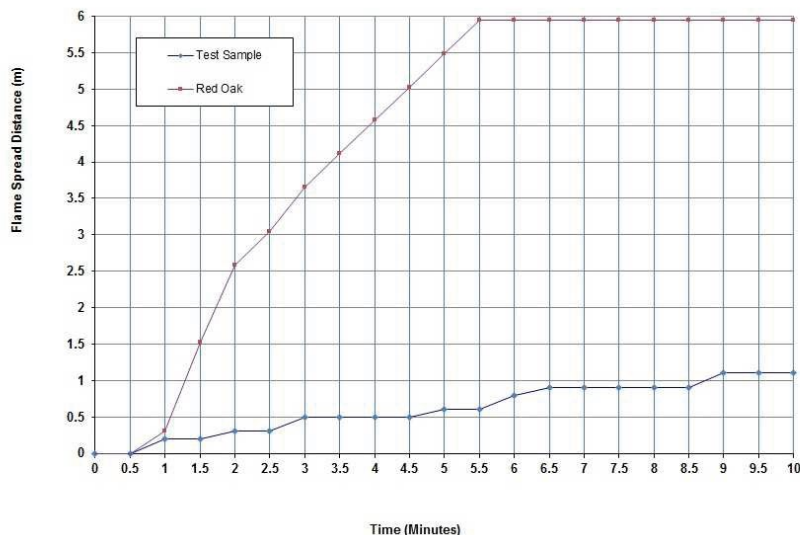


Figure 3. Flame Spread Chart

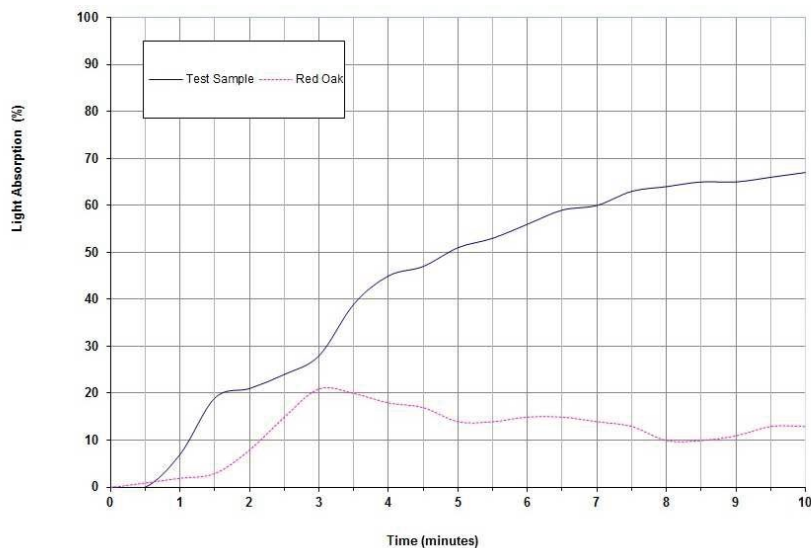


Figure 4. Smoke Developed Chart

***** To be continued *****

TEST REPORT

No. : XMIN180100115CCM

Date : Feb.14, 2018

Page: 5 of 6

Graphical Results:

Sample 3

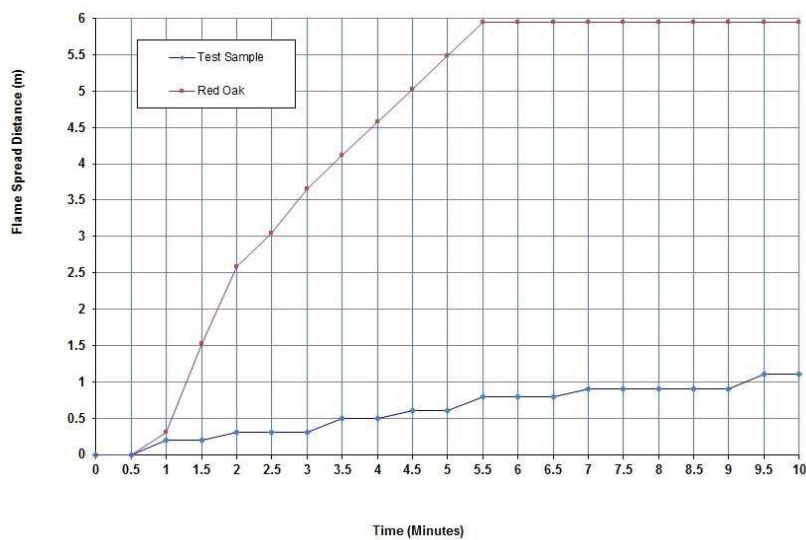


Figure 5. Flame Spread Chart

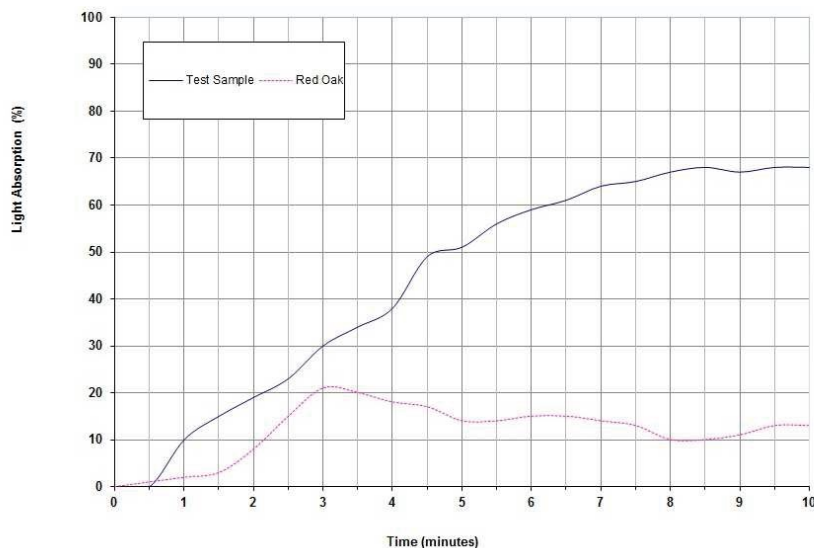


Figure 6. Smoke Developed Chart

Remark: The above test was carried out by SGS-CSTC Standards Technical Services Co., Ltd. Shunde Branch.

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180100115CCM


Date : Feb.14, 2018

Page: 6 of 6

SAMPLE INFORMATION AND PICTURES

Thickness: About 5mm
Test face: Sample face

Specimen photographs:

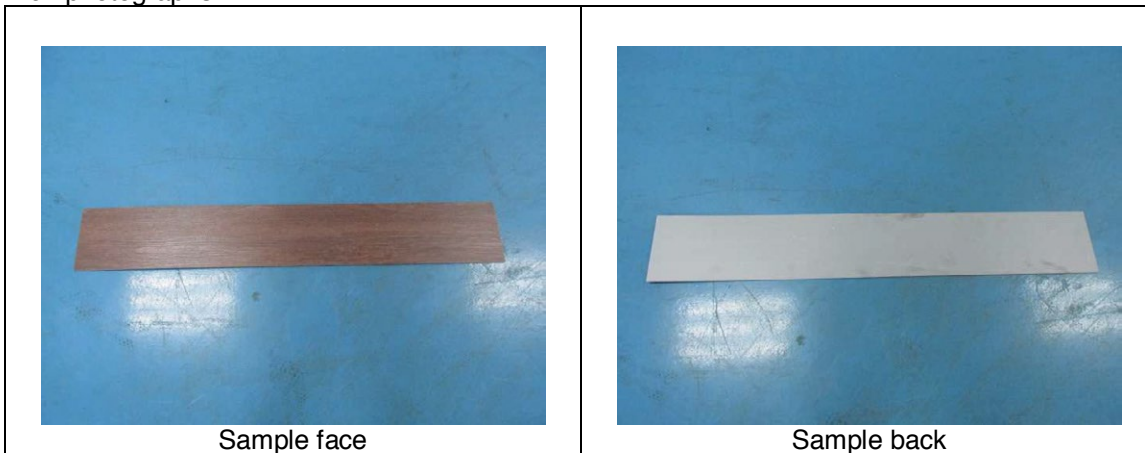

SGS authenticate the photos on original report only

*****End of report*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC (Shanghai) Inspection & Testing Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com



TEST REPORT

No. : XMIN190200283CCM

Date : Mar.11, 2019

Page : 1 of 3

CUSTOMER NAME: MASTER BUILDING PRODUCTS COMPANY
ADDRESS: 10380 NW 53RD STREET, SUNRISE, FL 33351
Sample Name : SPC FLOOR
Material : Vinyl
Spec. : PARKAY XPR COLLECTION

Above information and sample(s) was/were submitted and confirmed by the client. SGS, however, assumes no responsibility to verify the accuracy, adequacy and completeness of the sample information provided by client.

Test Required : Selected test(s) as requested by applicant
SGS Ref. No. : GZIN1902006577CM
Date of Receipt : Feb.20, 2019
Testing Start Date : Feb.20, 2019
Testing End Date : Mar.01, 2019
Test result(s) : For further details, please refer to the following page(s)
(Unless otherwise stated the results shown in this test report refer only to the sample(s) tested)

***** To be continued*****

Signed for
SGS-CSTC Standards Technical
Services Co., Ltd Xiamen Branch
Testing Center

Civi Huang
Authorized signatory



SGS-CSTC Standards Technical Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT

No. : XMIN190200283CCM


Date : Mar.11, 2019

Page : 2 of 3

Summary of Results:

No.	Test Item	Test Method	Result
1	Assessment of static electrical propensity	EN 1815:2016 Method A	Voltage: 0.2kV

Original Sample Photo:

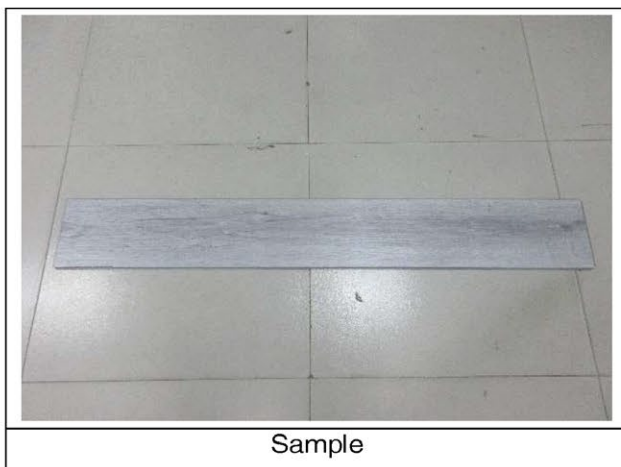

Sample

***** To be continued*****



SGS-CSTC 检测技术有限公司
Xiamen Branch Testing Center Commercial Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN190200283CCM

Date : Mar.11, 2019

Page : 3 of 3

Test item: Assessment of static electrical propensity

Sample description: See the photo

Test method: EN 1815:2016 Method A

Test condition:

Condition the test piece and the sandals at a temperature of $23\pm 2^{\circ}\text{C}$ and relative humidity of $25\pm 2\%$ for 7days, and maintain these conditions during testing.

With the hand electrode in the hand, walk on the test piece with regular paces at a rate of two steps per second, forwards and backwards but always with the body facing the same direction. At each step, lift the sandals approximately between 50 mm and 80 mm above the test piece. Lift and lower the sandal sole in a plane parallel to the test piece. Cover as much of the test piece as possible and continue walking until the peak voltage ceases to rise, but for not more than 60 s. Take off the sandals while still on the test piece. Perform the test three times.

Test result:

The following body voltages were determined:

Sample No.	1	2	3	Mean value
Voltage, kV (Rubber sole)	0.2	0.2	0.2	0.2

Remark: The above test was carried out by SGS-CSTC Standards Technical Services Co., Ltd. GuangZhou Branch.

***** End of report*****



SGS-CSTC Standards Technical Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180300374CCM

Date : Mar.26, 2018

Page: 1 of 5

CUSTOMER NAME: PARKAY FLOORS
 ADDRESS: 10360 NW 53RD STREET, SUNRISE, FL 33351
 Sample Name : RIGID LVT PLANK
 Spec. : PARKAY XPR COLLECTION
 Sample Information : 26/02/2018

Above information and sample(s) was/were submitted and confirmed by the client. SGS, however, assumes no responsibility to verify the accuracy, adequacy and completeness of the sample information provided by client.

Test Required : Selected test(s) as requested by applicant
 Date of Receipt : Mar.01, 2018
 Testing Start Date : Mar.01, 2018
 Testing End Date : Mar.15, 2018
 Test result(s) : For further details, please refer to the following page(s)
 (Unless otherwise stated the results shown in this test report refer only to the sample(s) tested)

***** To be continued*****

Signed for
 SGS-CSTC Standards Technical
 Services Co., Ltd. XM Branch



Civi Huang Authorized Signatory



SGS-CSTC Standards Technical Services Co., Ltd.
 Xiamen Branch Testing Center Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com
 中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180300374CCM

Date : Mar.26, 2018

Page: 2 of 5

Test Conducted:

Refer to ASTM E492-09(2016)^{ε1} Standard Test Method for Laboratory Measurement of Impact Sound Transmission Through Floor-Ceiling Assemblies Using the Tapping Machine
ASTM E989-06(2012) Standard Classification for Determination of Impact Insulation Class (IIC)

Test Condition:

Sample Description : RIGID LVT PLANK (see the photo)
Total Thickness:6.0mm, surface density: about 9.7kg/m²

Project description : No decoration of sample surface, sample installation was assembled directly.
The test specimen was covered on a 150mm concrete floor with a drop ceiling, testing area 11.3m², the drop ceiling construction showed in appendix2
Drop ceiling: 288mm cavity filled with 50mm glass wool, 12mm gypsum board.

Test method : Two adjacent rooms, one the source room directly above the other the receiving room. A standard tapping machine is placed in operation on the flooring system in source room. The average spectrum of the sound pressure levels produced by the tapping machine is measured in the receiving room.

Test Equipment : RTA840 system

Test Environment : Source room volume 125m³, receiving room volume 100m³,
air temperature 17.5°C, air humidity 30.8%

Test Result

Test Item	Test Standard	Result
Determination of Impact Sound Insulation Class	ASTM E492-09(2016) ^{ε1} ASTM E989-06(2012)	IIC = 66

***** To be continued *****



SGS-CSTC (Shanghai) Technical Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT


No. : XMIN180300374CCM

Date : Mar.26, 2018

Page: 3 of 5

Appendix 1:

f Hz	Ln dB
100	50.0
125	51.3
160	53.7
200	47.9
250	46.3
315	37.9
400	35.1
500	31.3
630	27.3
800	25.2
1000	16.1
1250	13.4
1600	12.2
2000	12.1
2500	11.3
3150	11.7
4000	17.3
IIC	66

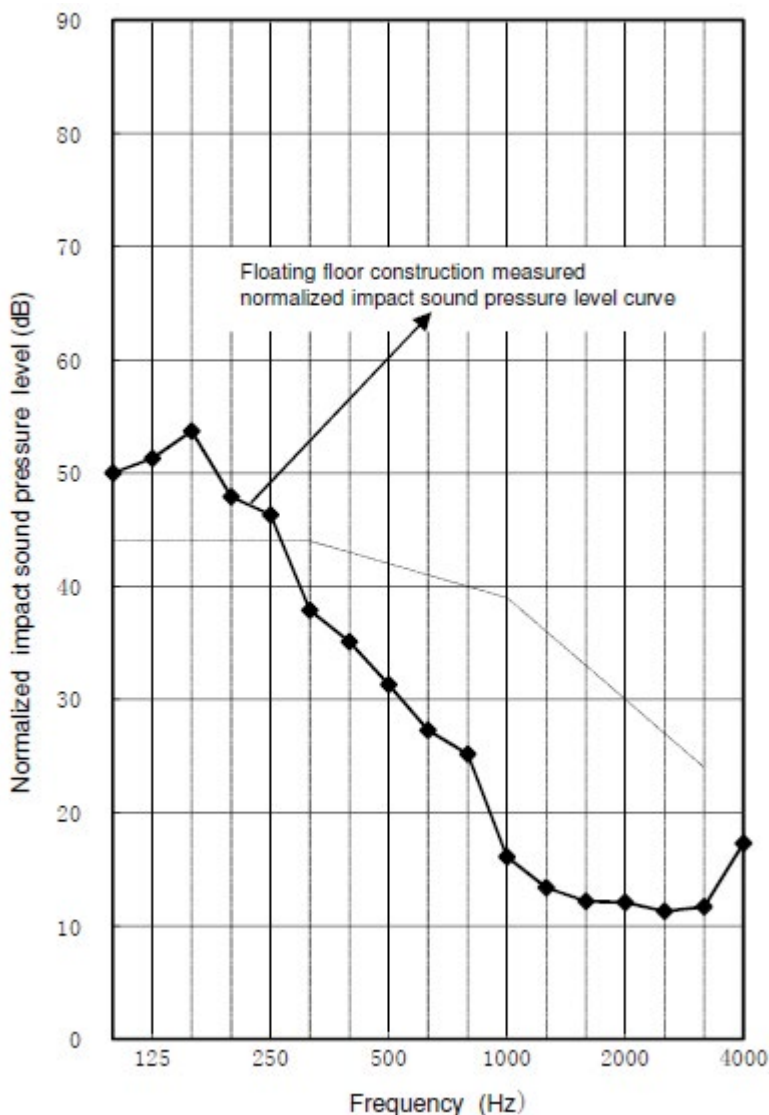

Remark: L_n as the weighted normalized impact sound pressure level

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com


TEST REPORT

No. : XMIN180300374CCM


Date : Mar.26, 2018

Page: 4 of 5

Appendix 2: The constructional drawing of the floor/ceiling assembly system

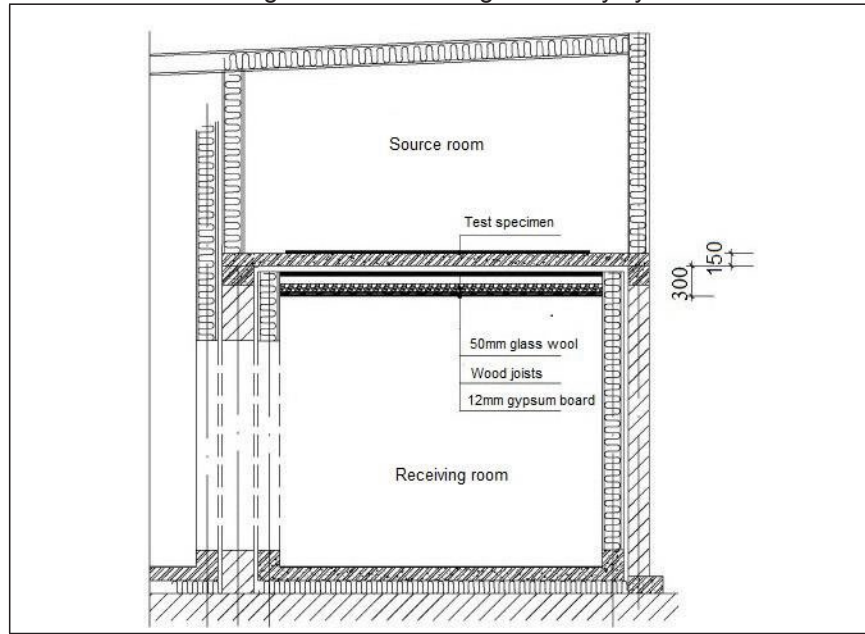

Schematic diagram:

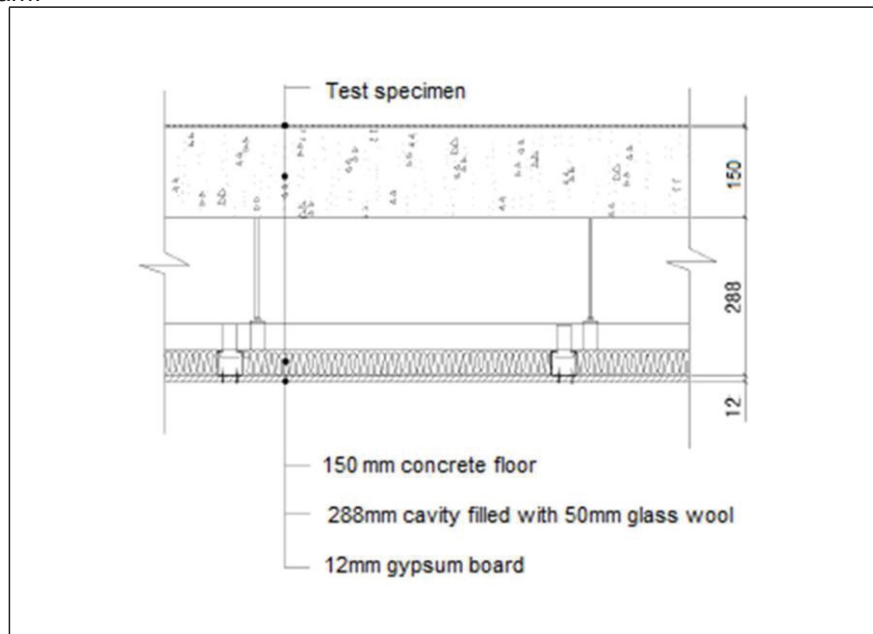

Note: The above test was carried out by Center for Building Environment Test, Tsinghua University.

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT

No. : XMIN180300374CCM

Date : Mar.26, 2018

Page: 5 of 5

Photo Appendix:



SGS authenticate the photo on original report only
***** End of report *****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC 检测技术有限公司 厦门分公司
Xiamen Branch Testing Center Construction Material Laboratory

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT

No. : XMIN180300375CCM

Date : Mar.26, 2018

Page: 1 of 5

CUSTOMER NAME: PARKAY FLOORS
ADDRESS: 10360 NW 53RD STREET, SUNRISE, FL 33351

Sample Name : RIGID LVT PLANK
Spec. : PARKAY XPR COLLECTION
Sample Information : 26/02/2018

Above information and sample(s) was/were submitted and confirmed by the client. SGS, however, assumes no responsibility to verify the accuracy, adequacy and completeness of the sample information provided by client.

Test Required : Selected test(s) as requested by applicant
Date of Receipt : Mar.01, 2018
Testing Start Date : Mar.01, 2018
Testing End Date : Mar.15, 2018
Test result(s) : For further details, please refer to the following page(s)
(Unless otherwise stated the results shown in this test report refer only to the sample(s) tested)

***** To be continued*****

Signed for
SGS-CSTC Standards Technical
Services Co., Ltd. XM Branch



Civi Huang Authorized Signatory



SGS-CSTC Standards Technical Services Co., Ltd.
Xiamen Branch Testing Center Commercial Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

No. : XMIN180300375CCM

Date : Mar.26, 2018

Page: 2 of 5

Test Conducted:

Refer to ASTM E90-09(2016) Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions and Elements
ASTM E413-16 Classification for Rating Sound Insulation

Test Condition:

Sample Description : RIGID LVT PLANK (see the photo)
Total Thickness:6.0mm, surface density: about 9.7kg/m²

Project description : No decoration of sample surface, sample installation was assembled directly.
The test specimen was covered on a 150mm concrete floor with a drop ceiling, testing area 11.3m², the drop ceiling construction showed in appendix2
Drop ceiling: 288mm cavity filled with 50mm glass wool, 12mm gypsum board.

Test method : Two adjacent rooms, one the source room directly above the other the receiving room. Taken the only significant sound transmission path between rooms is by way of the test partition. An approximately diffuse sound field is produced in the source room. Sound incident on the test partition causes it to vibrate and create a sound field in the receiving room.

Test Equipment : RTA840 system

Test Environment : Source room volume 125m³, receiving room volume 100m³,
air temperature 17.5°C, air humidity 30.8%

Test Result

Test Item	Test Standard	Result
Airborne sound transmission loss test and class	ASTM E90-09(2016) ASTM E413-16	STC = 68

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgsgroup.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT


No. : XMIN180300375CCM

Date : Mar.26, 2018

Page: 3 of 5

Appendix 1:

f Hz	TL dB
100	46.2
125	46.3
160	50.9
200	54.9
250	57.6
315	60.8
400	63.8
500	65.3
630	67.5
800	69.9
1000	76.6
1250	79.3
1600	79.3
2000	79.4
2500	77.1
3150	75.7
4000	73.4
5000	73.3
STC	68

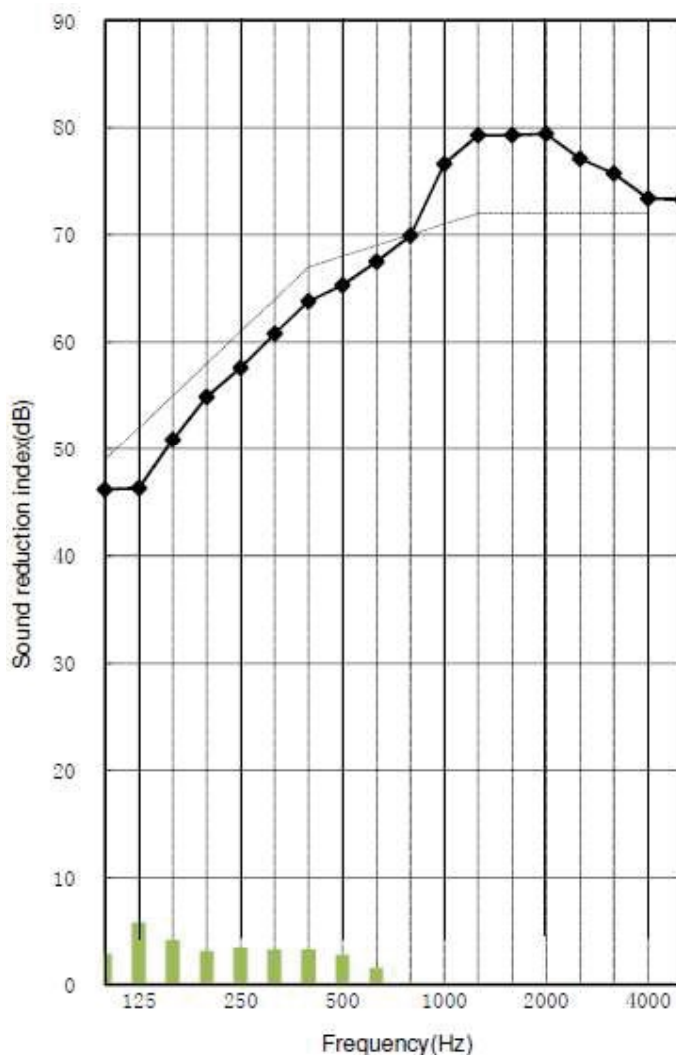

Remark: TL is the transmission loss.

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com


TEST REPORT

No. : XMIN180300375CCM


Date : Mar.26, 2018

Page: 4 of 5

Appendix 2: The constructional drawing of the floor/ceiling assembly system

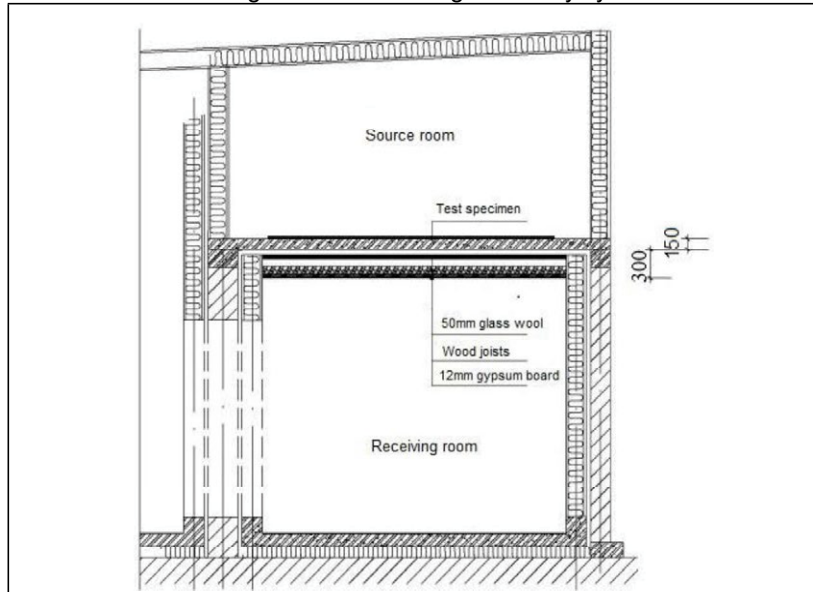

Schematic diagram:

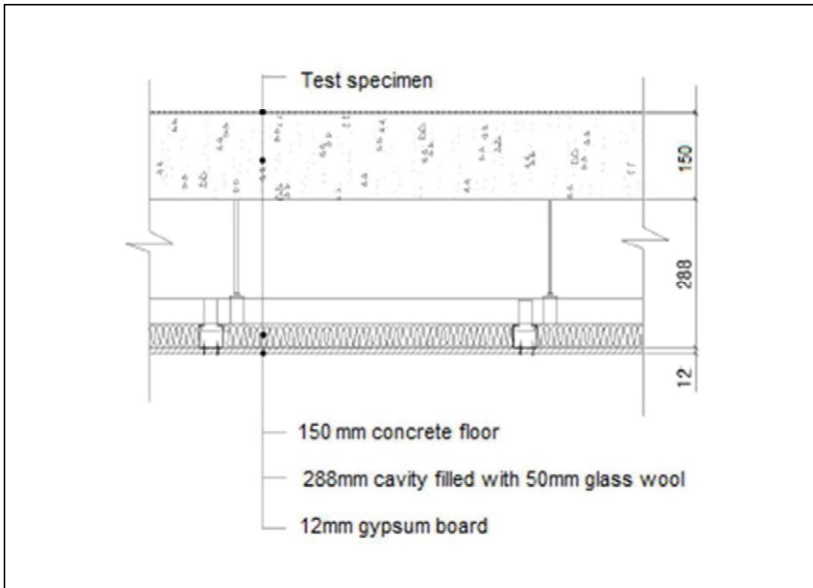

Note: The above test was carried out by Center for Building Environment Test, Tsinghua University.

***** To be continued*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com


TEST REPORT

No. : XMIN180300375CCM

Date : Mar.26, 2018

Page: 5 of 5

Photo Appendix:

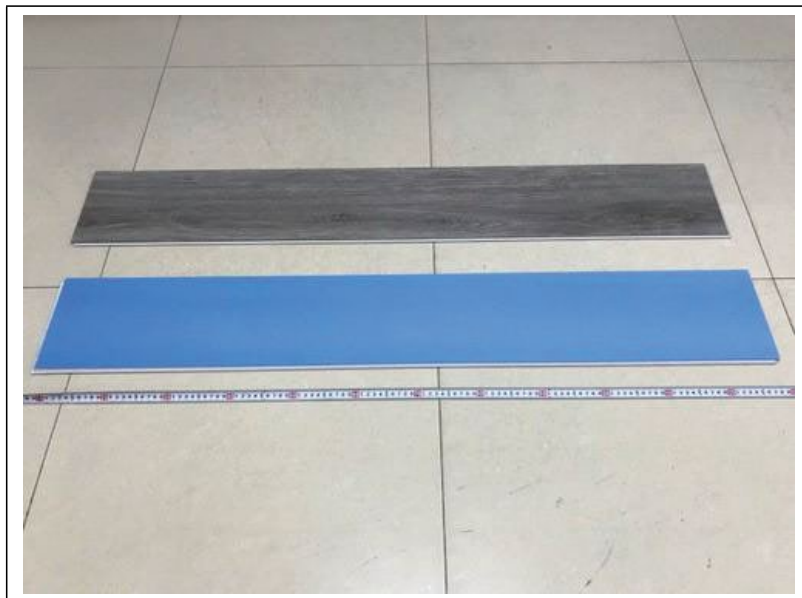

SGS authenticate the photo on original report only
*****End of report*****



SGS-CSTC 检测技术有限公司 厦门分公司
Xiamen Branch Testing Center Construction Material Laboratory

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.

Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

No.31 Xianghong Road, Xiang'an Torch Industrial Zone, Xiamen, Fujian Province, China. 361101 t (86-592) 5765857 f (86-592) 5765380 www.sgs.com.cn
中国·福建·厦门·火炬(翔安)产业区翔虹路31号 邮编:361101 t (86-592) 5765857 f (86-592) 5765380 e sgs.china@sgs.com

TEST REPORT

EN 14041+AC

Resilient, textile and laminate floor covering — Essential Characteristics

Report Reference No.....: 170510110GZU-001

Tested by (name and signature).....: Kelming Wang *Kelming Wang*

Approved by (name and signature)..: Jeff Deng *Jeff Deng*

Date of issue.....: July 14, 2017

Contents.....: Total test report 14 pages including:
Report text: 5 pages.
Appendix A for copy of test report (Issued by: NB 1023): 6 pages.
Appendix B for ISO 9001 certificate: 1 page
Appendix C for Product photos: 1 page
Appendix D for Revision page: 1 page

Testing Laboratory name: Intertek Testing Services Shenzhen Ltd. Guangzhou Branch

Address.....: No. 9 Nan Xiang San Road, GETDD, Guangzhou, China

Testing location.....: Same as above and Notified Body No. 1023

Applicant's name.....: [Redacted]

Address.....: [Redacted]

Test specification:

Standard.....: EN 14041: 2004+AC: 2006

Non-standard test method.....: N/A

Test Report Form No.....: TTRF EN 14041: 2004 C

TTRF Originator.....: Intertek Testing Services Shenzhen Ltd. Guangzhou Branch

Master TTRF.....: Dated 2013-01

Test item description.....: PVC floor covering-Diamond, Rigid LVT


Model and/or type reference.....: Diamond, Rigid LVT 5.0mm

Manufacturer.....: [Redacted]

Rating(s).....: Reaction to fire: Class B_{fl}-S1
Release of formaldehyde: Class E1

Copy of marking plate:

Marking on accompanied document :

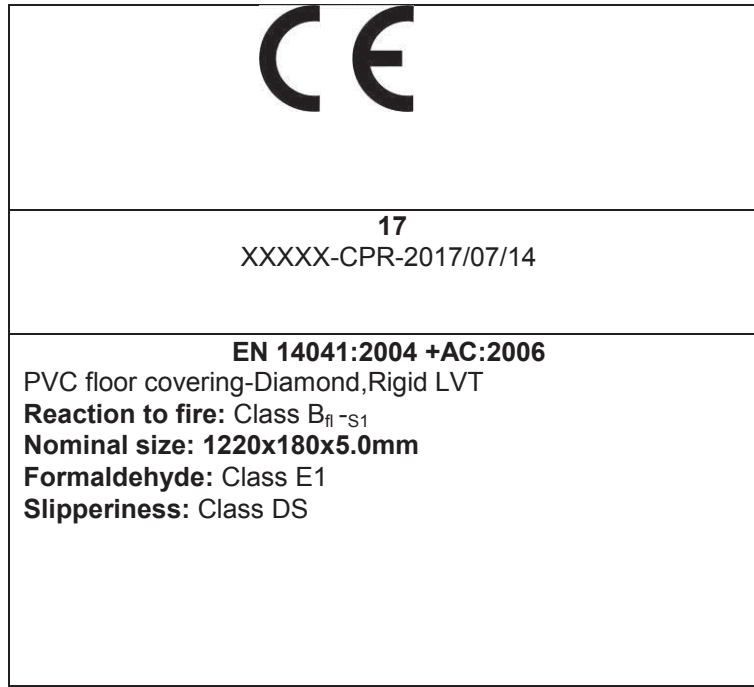

Note:

1. If the CE marking is reduced or enlarged the proportions given in the above graduated drawing must be respected.
2. The various components of the CE marking must have substantially the same vertical dimension, which may not be less than 5 mm.
3. CE marking and label shall be affixed visibly, legibly and indelibly.
4. "XXXXX-CPR-2017/07/14" should be the reference number of the DoP.

Summary of testing:

The submitted samples were tested and found to comply with applicable requirements of EN 14041: 2004+AC: 2006.

Test item particulars
Classification of installation and use : Floated (no adhesive)
Possible test case verdicts:
- test case does not apply to the test object : N/A
- test object does meet the requirement..... : P(Pass)
- test object does not meet the requirement..... : F(Fail)
Testing
Date of receipt of test item : May 10, 2017
Date (s) of performance of tests : May 10, 2017 to July 14, 2017
General remarks:
This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to permit copying or distribution of this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program. "(See remark #)" refers to a remark appended to the report. "(See Appendix #)" refers to an appendix appended to the report. Throughout this report a comma (point) is used as the decimal separator. When determining the test result, measurement uncertainty has been considered. The clause which indicated with * is the subcontract test item.

General product information:
Submitted samples are PVC floor covering-Diamond,Rigid LVT, thickness: 5mm, refer to below product information: Model no.: Diamond, Rigid LVT 5.0mm Top film(wear layer):0.5mm PVC Base layer:3.85mm PVC Balance layer:0.65mm PVC Compound: Calcium carbonate, PVC powder, colorant(carbon black),stabilizing agent Form of floor covering: tile; work size: 1220*180*5.0 mm Way of the product laying: floated (no adhesive) Release of formaldehyde, Reaction to fire (Class B₁) test conducted by Notified Body Lab No.1023. INSTITUTE FOR TESTING AND CERTIFICATION, Inc. Refer to report No. 75 35 01489/2017 for detail. See Appendix C for products' appearance.

EN 14041+AC			
Clause	Requirement - Test	Result - Remark	Verdict
4	REQUIREMENTS		—
4.1	*Reaction to fire When declared, the floor covering shall be tested and classified according to the requirement of EN 13501-1 and resulting class and subclass shall be declared If it is decided to make no claim for reaction for fire performance, which marked Class F, no testing is required If the product listed in Table 1, 2 or 3, in the end uses identified in the tables, are classified without further testing in the classes shown and do not require testing in respect of these end uses and classes	Class B_{fl}-S₁ Refer to report No. 75 35 01489/2017 for detail	P
4.2	Content of pentachlorophenol (PCP) Resilient, textile and laminate floor coverings shall not contain PCP or derivative thereof as a component in the production process of the product or of its raw materials	PVC floor covering Not applicable.	N/A
4.3	*Formaldehyde emission When formaldehyde-containing materials have been added to the product as a part of the production process, the product shall be tested and classified in to one of two classes: E1 or E2	Class E1 Refer to report No. 75 35 01489/2017 for detail.	P
4.4	Water-tightness Where required, resilient floor coverings shall meet the requirement of EN 13553.....	Not claimed	—
4.5	Slip resistance When declared, the floor covering intended to be used in dry and non-contaminated conditions shall have a dynamic coefficient of friction of $\geq 0,30$ when tested ex-factory under dry conditions per EN 13893 and shall be declared as technical class DS.....	Dynamic coefficient of friction: 0.36 Class DS	P
4.6	Electrical behaviour (static electricity) When declared, antistatic floor coverings body voltage shall not exceed 2,0 kV per EN 1815 When declared, static dissipative floor coverings vertical resistance shall not exceed $10^9 \Omega$ per EN 1081..... When declared, conductive floor coverings vertical resistance shall not exceed $10^6 \Omega$ per EN 1081.....	Not claimed	—

EN 14041+AC			
Clause	Requirement - Test	Result - Remark	Verdict
4.7	*Thermal conductivity If required, the thermal conductivity values shall be verify per EN 12524 or EN 12667.....:	0.151 W/m•K by test	—
5	EVALUATION OF CONFORMITY		—
5.1	General	Refer to 5.3	P
5.2	Type testing	Refer to Clause 4.1 to 4.7	P
5.3	Factory production control	The manufacturer claimed compliance with the FPC requirements by operating an ISO 9001 system and holds valid ISO9001 certificate.	P
6	MARKING		—
	Product which conform to the requirements of this document shall be clearly and indelibly marked by the manufacturer either on their package or on an adhesive label with following information: a) the number and the year of this European Standard b) the manufacturer's or supplier's identification c) the product name and batch number	See 'Copy of marking plate'.	P

*****End of page*****

Appendix A
Copy of Test Report (Issued by: NB 1023)

Reference No. 75 35 01489
Page 1 of 6



INSTITUTE FOR TESTING AND CERTIFICATION
třída Tomáše Bati 299, Louky, 763 02 Zlín, Czech Republic

TEST REPORT

Reference No. 75 35 01489/ 2017

Product: **Heterogeneous PVC floor covering,
type: Diamond 5.0**

Elaborated by: Milan Kovář

Issued on: 22nd June 2017




RNDr. Radomir Čevelík
Representative of Notified Body No. 1023

Tax & VAT id No.: CZ47910381
Company id No.: 47910381

Phone: +420 577 601 238
+420 577 601 623

Fax: +420 577 104 855
+420 577 601 702

e-mail: itc@itczlin.cz
www.itczlin.cz

*****End of Page*****

Appendix A (continued)
Copy of Test Report (Issued by: NB 1023)



INSTITUTE FOR TESTING AND CERTIFICATION

Notified Body 1023
 763 02 Zlín, Czech Republic

Notified Body No. 1023 * State Authorized Body No. 224 * Product and Management Systems Certification Bodies * Accredited Laboratory

Reference No. 75 35 01489
 Page 2 of 6

1. Introduction

This report was elaborated on the basis of the application No. 753501489, registered on 12/05/2017 and tests results carried out by the notified testing laboratory in accordance with the procedure mentioned in the article 1.4 of the Annex V to the Regulation (EU) No. 305/2011 of the European Parliament and of the Council of 9 March 2011, as amended, laying down harmonised conditions for the marketing of construction products („CPR“).

2. Assessment and verification of constancy of performance according to Regulation (EU) No 305/2011 of the European Parliament and of the Council, as amended

Floor coverings as construction products are assessed on the basis of relevant clauses of the Regulation (EU) No 305/2011 of the European Parliament and of the Council of 9th March 2011 laying down harmonised conditions for marketing of construction products and repealing Council Directive 89/106/EEC as amended (called „CPR“)

2.1 System of assessment and verification of constancy of performance (AVCP)

The submitted product is assessed pursuant to system of AVCP 3 of the CPR (Annex V).
 The type testing was carried out according to Annex ZA of the standard ČSN EN 14041 (EN 14041:2004/AC:2006).

2.2 Indicators specifying basic requirements for construction works

The initial type testing was carried out by the notified body (the notified test laboratory) in the following range of relevant properties according to Table ZA.4 (of the ČSN EN 14041):

- Reaction to fire
 - ignitability – surface exposure according to ČSN EN ISO 11925-2 (exposure time: 15s)
 - burning behaviour using a radiant heat source according to ČSN EN ISO 9239-1 /test samples were not glued to the standard substrate/
 - classification according to ČSN EN 13501-1+A1
- Formaldehyde emission according to ČSN EN 717-1

*****End of Page*****

Appendix A (continued)
Copy of Test Report (Issued by: NB 1023)



INSTITUTE FOR TESTING AND CERTIFICATION

Notified Body 1023

763 02 Zlín, Czech Republic

Notified Body No. 1023 * State Authorized Body No. 224 * Product and Management Systems Certification Bodies * Accredited Laboratory

Reference No. 75 35 01489

Page 3 of 6

2.3 Product specification

PVC heterogeneous floor covering tiles.

Dimensions: 1220 mm x 180 mm x 5.0 mm

Composition:

- Wear layer: 0.5 mm (PVC)
- Base layer: 3.85 mm (PVC)
- Balance layer: 0.65 mm (PVC)

Total thickness (wear layer thickness): 5.0 mm (0.5 mm)

Laying way: click, loose (no adhesive)


2.4 Sampling place and number of samples taken

The test samples were sent by the manufacturer. The number of the test samples sent was as follows:

- PVC heterogeneous floor covering tiles, type: Diamond 5.0 mm in the amount of 56 pcs tiles, 1 pc (approx. 0.5 x 0.5) m, packed into foil, 1 pc of (approx. 185 x 1000) mm

The test samples were registered under the registration number 75 35 01489/1 on 23/05/2017.

Sample photo:

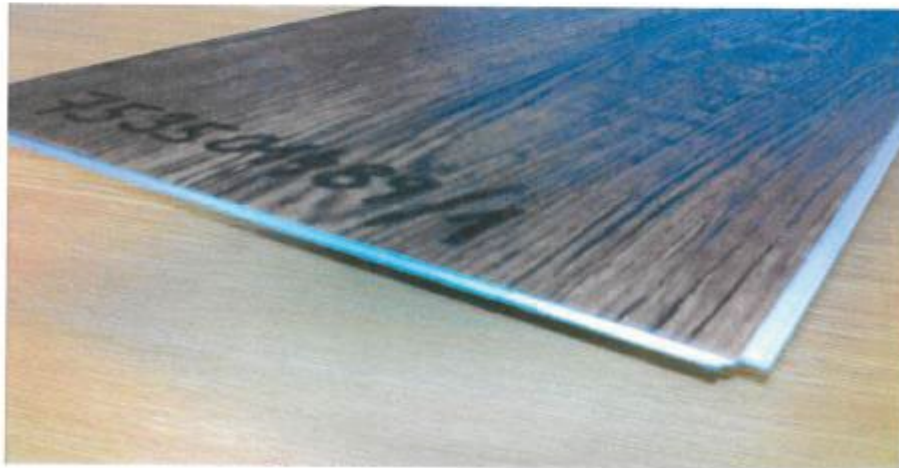

*****End of Page*****

Appendix A (continued)
Copy of Test Report (Issued by: NB 1023)



INSTITUTE FOR TESTING AND CERTIFICATION

Notified Body 1023
 763 02 Zlín, Czech Republic

Notified Body No. 1023 * State Authorized Body No. 224 * Product and Management Systems Certification Bodies * Accredited Laboratory

Reference No. 75 35 01489
 Page 4 of 6

2.5 Place and date of testing

- Institut pro testování a certifikaci (ITC), a.s., NB 1023, accredited laboratory No. 1004 Zlín (June 2017)
- Centrum stavebního inženýrství (CSI), a.s. Prague, Fire Technical Laboratory, Accredited test laboratory No.1007.4, NB 1390 (June 2017)
- Výzkumný a vývojový ústav dřevařský, Praha, s.p., NB 1393, accredited laboratory No. 1031, Prague (May 2017)

2.6 Test results

2.6.1 Ignitability results

Table 1 – Ignitability test results

Characteristic	Surface exposure test – lengthwise direction (characteristic for individual test specimens)	Surface exposure test – crosswise direction (characteristic for individual test specimens)
Ignition of the test specimen Yes/No	No, No, No, No, No	No, No, No, No, No
Flame reaching of a mark in distance of 150 mm Yes/No	No, No, No, No, No	No, No, No, No, No
Burning time to reach 150 mm (s)	" ₁ " " ₂ " " ₃ " "	" ₁ " " ₂ " " ₃ " "
Ignition of the filter paper	No, No, No, No, No	No, No, No, No, No

*****End of Page*****

Appendix A (continued)
Copy of Test Report (Issued by: NB 1023)



INSTITUTE FOR TESTING AND CERTIFICATION

Notified Body 1023
 763 02 Zlín, Czech Republic

Notified Body No. 1023 * State Authorized Body No. 224 * Product and Management Systems Certification Bodies * Accredited Laboratory

Reference No. 75 35 01489
 Page 5 of 6

2.6.2 Results of burning behaviour using a radiant heat source

Table 2 - Results of burning behaviour using a radiant heat source

Characteristic	Measuring unit	Crosswise direction measurement	Lengthwise direction measurement (mean value)
Maximum distance of flame spread	mm	190	206.7
Critical heat flux (CHF)	kW/m ²	9.3	9.0
Distance of flame spread at 10th min.	mm	180	206.7
HF-10	kW/m ²	9.5	9.0
Distance of flame spread at 20th min.	mm	(-)	(-)
HF-20	kW/m ²	(-)	(-)
Distance of flame spread at 30th min.	mm	(-)	(-)
HF-30	kW/m ²	(-)	(-)
Maximum light attenuation	%	56.9	60.3
Integrated smoke value	% x min	213.7	243.4

2.6.3 Results of the reaction to fire classification

Table 3 – Reaction to fire classification

Product	Reaction to fire class	Additional class for smoke production	Final class
Heterogeneous PVC floor covering, type: Diamond 5.0	B _{fl}	s1	B _{fl} – s1

*****End of Page*****

Appendix A (continued)
Copy of Test Report (Issued by: NB 1023)



INSTITUTE FOR TESTING AND CERTIFICATION

Notified Body 1023

763 02 Zlín, Czech Republic

Notified Body No. 1023 * State Authorized Body No. 224 * Product and Management Systems Certification Bodies * Accredited Laboratory

Reference No. 75 35 01489

Page 6 of 6

2.6.4 Formaldehyde emission result

Table 4 – Results of the formaldehyde emission

Product	Measuring unit	Test result (class)
Heterogeneous PVC floor covering, type: Diamond 5.0	mg.m ⁻³	0.005 (E1)

Notified Body NB 1023 has carried out the testing in accordance with the paragraph 1.4 of Annex V to the Regulation (EU) No 305/2011, as amended for the product specified in the Art. 2.3 of this Report **and concluded that**

all requirements of this paragraph of the above Regulation and the relevant harmonized standard have been met and this report may be issued as a basis for affixing CE marking to these products.

This Report is applicable only to products identically marked and named, such as those which were the subject to testing, provided that the products characteristics have not been changed or no significant changes in their production (materials, technology, manufacturing equipment, etc.) have been done.

3. List of documents used to elaborate the Test Report

- Application No. 753501489 for assessment of CE-marked construction products
- ČSN EN 14041 (91 7883): Pružné textilní a laminátové podlahové krytiny – Podstatné vlastnosti (Resilient, textile and laminate floor coverings – Essential characteristics)
- Test Report of accredited laboratory, reference No. 753501489/01, elaborated by ITC a.s., accredited laboratory No. 1004, in Zlín, on 12/06/2017
- Test Report, reference No. 17/440/P341, elaborated by Centrum stavebního inženýrství a.s., Fire Technical Laboratory, Prague, on 22/06/2017
- Test Report, reference No. MVZ-A-2017-000111, elaborated by Výzkumný a vývojový ústav dřevařský, Praha, s.p., accredited laboratory No. 1031, Prague, on 05/06/2017
- Classification Report using Results of Reaction to Fire No. 75 35 01489K/2017, elaborated by ITC, a.s. Zlín, on 22/06/2017

*****End of Page*****

ISO 9001 certificate



*****End of page*****

Appendix C

Products photos

 A rectangular sample with a dark brown wood-grain finish is shown horizontally on a green surface. A yellow measuring tape is placed below the sample, indicating its length.	 A rectangular sample with a dark, possibly black, finish is shown horizontally on a green surface. A yellow measuring tape is placed below the sample, indicating its length.
C.1 Surface view of sample	C.2 Back view of sample
 A rectangular sample is shown at an angle on a green surface, revealing its thickness. A yellow measuring tape is placed next to it for scale.	Blank
C.3 Section view of sample	

*****End of page*****

Appendix D**Revision page**

Revision No.	Date	Changes	Author	Reviewer
0	July 14, 2017	First issue	Kelming Wang	Jeff Deng

*****End of report*****

SCS Global Services does hereby certify that an independent assessment has been conducted on behalf of:

For the following product(s):

Vinyl Tile Flooring:

BBL VINYL FLOOR (Maximum thickness: 5.0mm), Diamond Floor with EVA (Maximum thickness: 12mm),
Diamond Floor with IXPE (Maximum thickness: 12mm)

The product(s) meet(s) all of the necessary qualifications to be certified for the following claim(s):

FloorScore®

Indoor Air quality Certified to SCS-EC10.3-2014 v4.1

Conforms to the CDPH/EHLB Standard Method v1.2-2017 (California Section 01350), effective April 1, 2017, for the school classroom and private office parameters when modeled as Flooring.

Measured Concentration of Total Volatile Organic Compounds (TVOC): Less than/equal to 0.5 mg/m³ (in compliance with CDPH/EHLB Standard Method v1.2-2017)

Registration # SCS-FS-20014

Valid from: March 19, 2024 to March 31, 2025

SCS Global Services is currently the only certification body approved by the Resilient Floor Covering Institute (RFCI) to provide FloorScore® product certification; certified products are only listed on the SCS Green Products Guide, <http://www.scsglobalservices.com/certified-green-products-guide>.



A handwritten signature in black ink, appearing to read "Nicole Munoz".

Nicole Munoz, Vice President, ECS
SCS Global Services
2000 Powell Street, Ste. 600, Emeryville, CA 94608 USA

